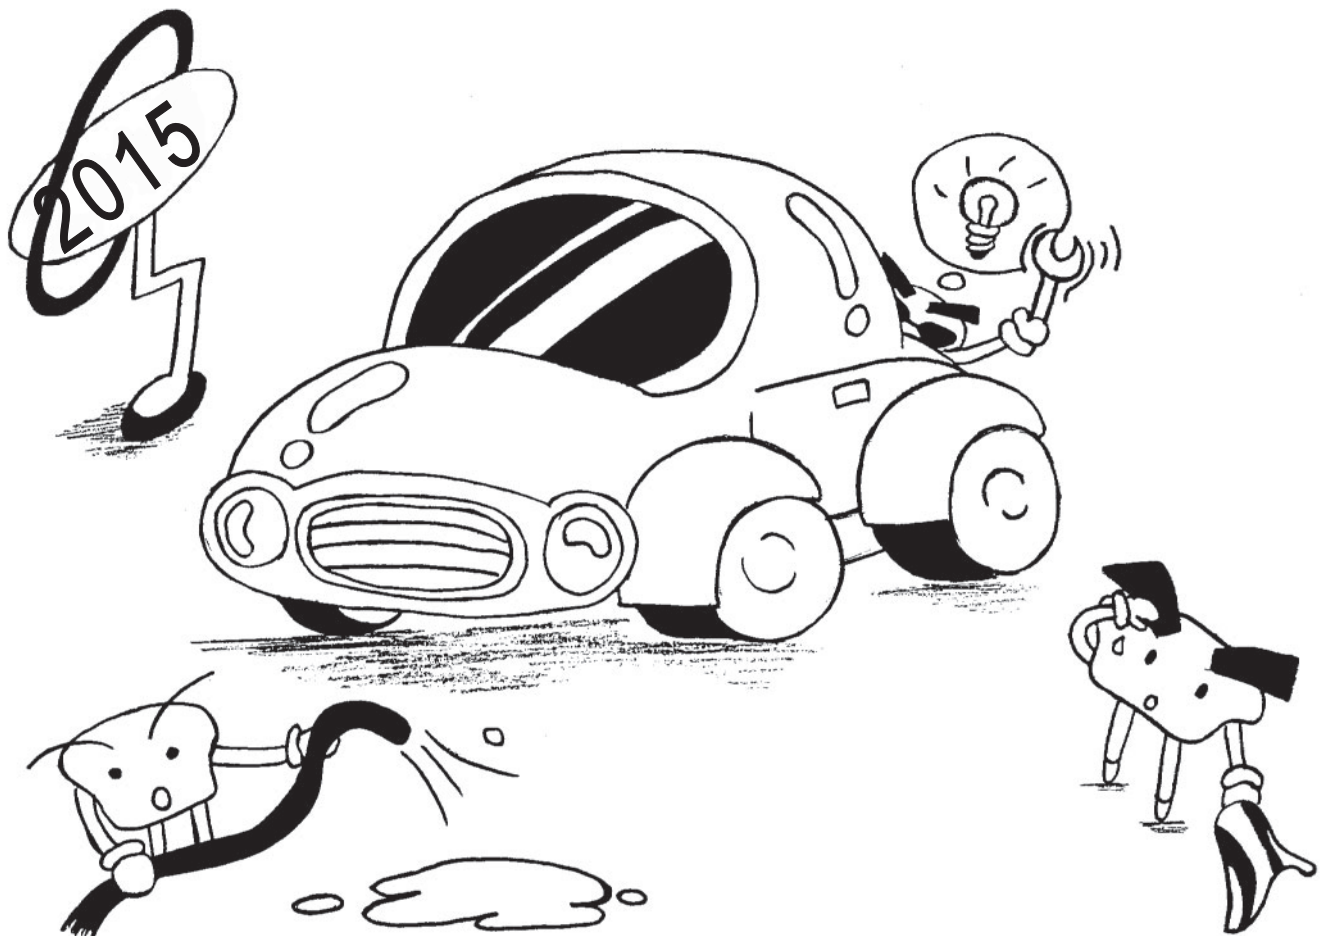



CONTENTS

DIRECTION FOR USING DISC BRAKE PAD.....	II, III, IV
BRAKE PAD & SHOE SELECTION GUIDE.....	V
GENERAL BRAKE PROBLEMS.....	VI
PART NUMERIC CODE.....	VII
MEASUREMENT FOR DRAWING.....	VIII
APPLICATION DATA - INDEX.....	IX
APPLICATION DATA.....	1
ILLUSTRATIONS FOR BRAKE SHOE.....	359
ILLUSTRATIONS FOR BRAKE PAD.....	485





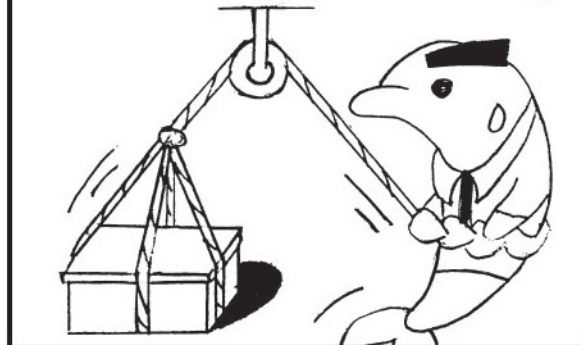
DIRECTION FOR USING DISC BRAKE PAD

CAUTION FOR SAFEKEEPING

Please avoid being exposed to direct sunlight or high temperature place.




Please do not throw, drop or use too violently.



Please stay away from grease and gas smelled place.




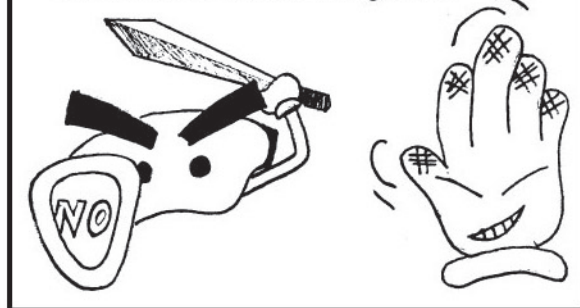Please do not touch the abrasive surface with the hand stained with grease.



CAUTION FOR INSPECTION

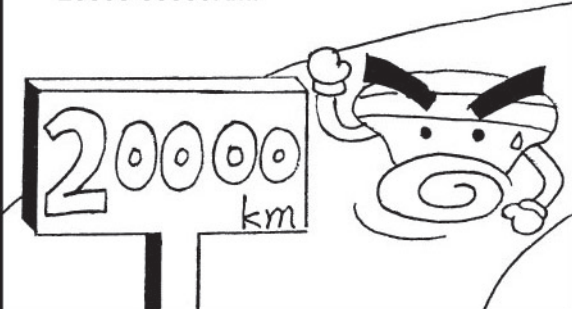Proceed with regular check after running 20000-30000KM.



Please proceed with regular check after running one-two years.




Please check when there is noise occurred.





Please check if one of the wheels is not working.






DIRECTION FOR USING DISC BRAKE PAD

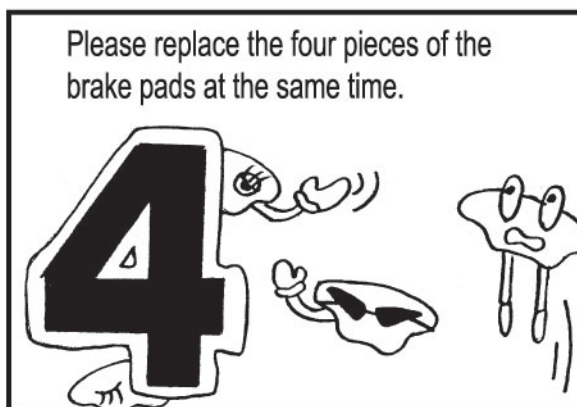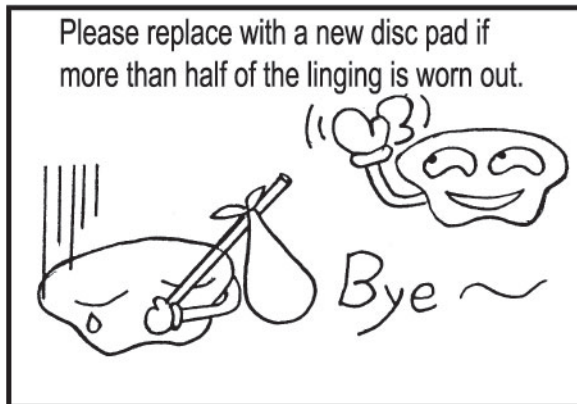CAUTION FOR REPLACEMENT






TECHNICAL INFORMATION


1. DISC/DRUM MACHING & PREPARATION	1. Machine disc/drum using the slowest feed rate. Do not use heavy cuts. The final cut should be minimal depth to minimise any grooving on the surface. 2. After machining, clean it with 240 grit emery on both surfaces to obtain a smooth non-directional surface finish.
2. CLEANING	Machining may leave a fine film of graphite on the surface. Always clean down the surface using methylated sprits after machining. After fitting, once again wipe down the disc.
3. BEDDING-IN PROCEDURE	To minimise the performance of brake pads, it is essential that they are bedded in correctly as follows. 1. Accelerate vehicle to 50 km/h 2. Apply brakes using moderate to firm pedal effort, reducing speed to 5 km/h 3. Drive 200m -300m accelerating to 50 km/h 4. Repeat steps 1 to 3 between 8-10 times



DIRECTION FOR USING DISC BRAKE PAD

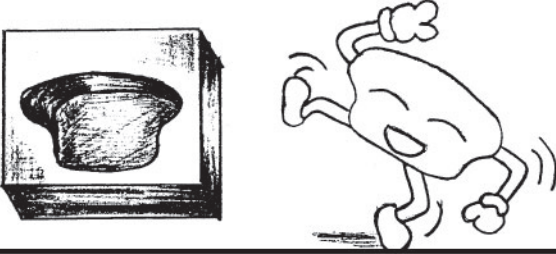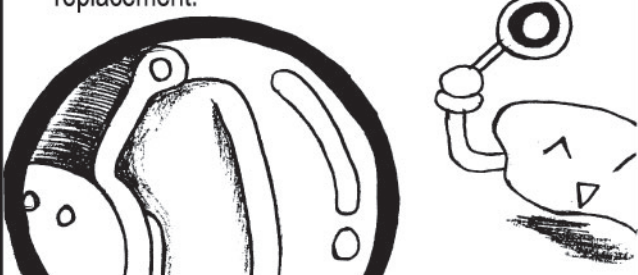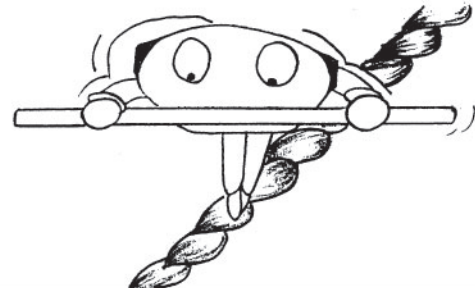CAUTION FOR INSTALLATION

Please make sure the exact Item No. for the car. 	Please don't take out Brake Pads from the Box before replacement. 
Please don't stain the Abrasive Surface with grease or oil. 	Please inspect the Disc and Caliper before replacement. 
Please push back the Piston completely before replacement. 	It's ok to assemble the Loose Replacement for small components, such as shim. 
Please make sure there's no Air in the Hydraulic System. 	Please fasten the Bolts tight when replacing. 
Please make sure installing in the exact position. 	Please make sure there's no Vibration on Rotor. 




BRAKE PAD & SHOE SELECTION GUIDE

BRAKE PAD

	FRICTION MATERIAL	APPLICATION	FEATURE
SEM	Semi-Metallic 100% Asbestos Free	Light to Heavy-Duty Vehicles, Passenger Cars & Light Trucks, SUV	Quiet Operation, High Temperature Resistance
LOM	Low-Metallic 100% Asbestos Free	Frequent Braking for Passenger Cars, Light Trucks, 4WD	Long Duration, Wear & Fade Resistance
NAO	Non-Asbestos Organic	Suitable for All Kinds of Vehicles	Low Noise, Low Dust, Extended Life
CEM	Ceramic	Suitable for All Kinds of Vehicles, Especially Performance One	Ultra Quiet, Low Dust, Quick Recovery From Fade

BRAKE SHOE

	FRICTION MATERIAL	APPLICATION	FEATURE
NAO	Non-Asbestos Organic	Suitable for All Kinds of Vehicles	Low Noise, Low Dust, Extended Life



GENERAL BRAKE PROBLEMS

BRAKE NOISE

Brake should operate with minimal amount of noise. However excessive squeal, screech, groaning grinding chatter or rattle means your brakes need attention.

Probable Cause	Corrective Action
Extremely rough rotor surface	Regrind rotors
Worn pads or linings	Replace with new pads or linings
Twisted brake shoe	Replace brake shoes
Weak or broken spring components	Replace with new springs
Drums out of round	Turn or replace drums
Loose wheel bearing	Adjust or replace faulty parts
Foreign particles embedded in material	Replace with new pads or linings
Faulty caliper alignment	Readjust
Too much lateral run out of rotor	Correct runout to manufacturers specs.

BRAKE VIBRATION

Brake pedal, steering wheel or entire wheel shakes, vibrates or pulsates when brake is applied

Probable Cause	Corrective Action
Rotor run out and parallelism	Resurface disc brake rotors
Wear in steering and suspension components	Examine and replace worn components
Wheels out of balance	Wheel balance required

BRAKE WEAR

Premature wear can be caused by a number of faults in the brake system. To avoid costly repairs have the brakes checked at least once a year.


Probable Cause	Corrective Action
Wrong type of pad or lining material for operating conditions	Replace with correct pad or lining material for application
caliper pistons and/or pins seized	Fit pin and seal kits
extremely rough rotor surface	Regrind rotors

IMPORTANT REMINDER


Changing brake pads is a simple job but there are few important things, which we introduce in former pages, usually missed or forgotten by installers, which can lead to noise, vibration and wear occurred. The most important of all is the DISK/DRUM Machining.

If rotor surface is uneven or damaged or has grooves over 0.3mm depth, it needs to be skimmed or turned by using an on-car lathe or taking it to work shop, otherwise, your new brake pads will not have a proper contact with rotor surface and that will lead to noise, vibration and fast wear out.

If rotor is in good condition, it's still important to sand the surfaces on both sides lightly with sandpaper to smooth the surface and remove any residue or pad adhesive that was left from the old brake pads which could contaminate the new pads. An orbital sander works well for this job, since it gives the rotor a non-directional finish recommended by most car manufacturers.



PART NUMERIC CODE

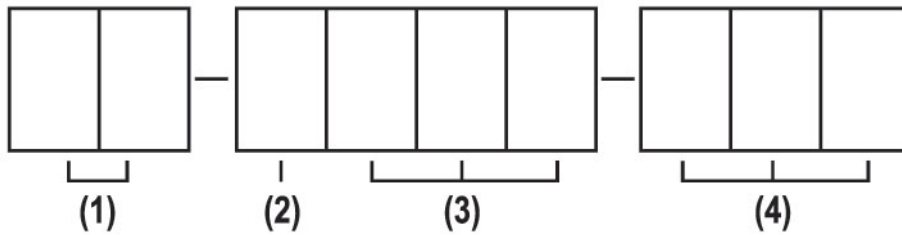

(1)

MD-DISC BRAKE PAD
MS-DRUM BRAKE SHOE

(2)


1 NISSAN	6 MITSUBISHI
2 TOYOTA	7 SUBARU
3 MAZDA	8 OTHERS(EUROPEAN,AMERICAN,KOREAN CAR)
4 ISUZU	9 SUZUKI
5 HONDA	0 DAIHATSU

(3)

INDICATES MFG. NUMBER

(4)


M - W / WEAR SENSOR
W - W / WEAR INDICATOR WIRE
S - W / SHIM
ACS - W / ACCESSARY(SAME AS OEM)
A or B - DIFFERENT LENGTH OR BONDING POSITION OF LINING ON SHOE
10,20~90 - DIFFERENT THICKNESS OR SLIGHT DIFFERENCE IN THE SHAPE WITH THE ORIGINAL NO. ON PAD




MEASUREMENT FOR DRAWING

DISC BRAKE PAD

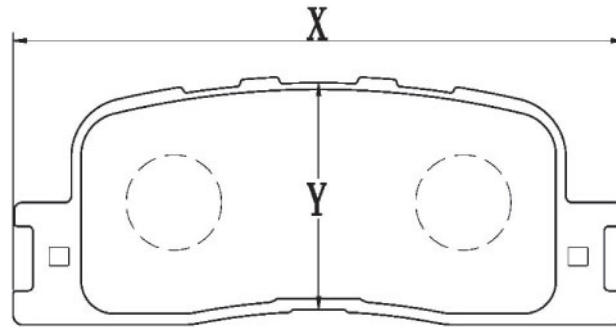A. Prefix 1,2,3,4,5,6,7,9,0




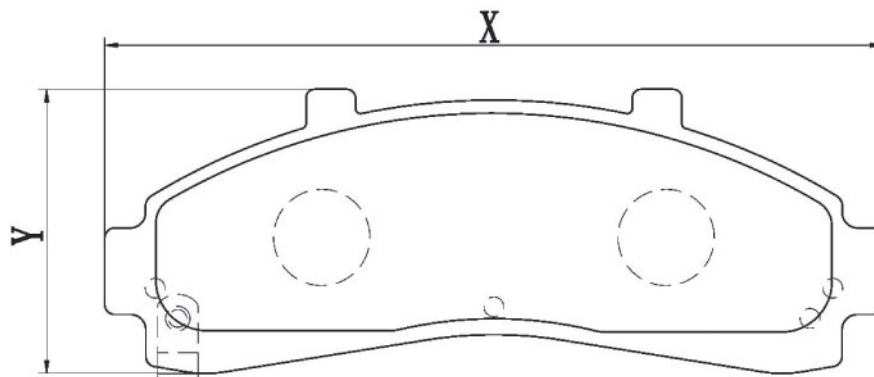
B. Prefix 8



DRUM BRAKE SHOE

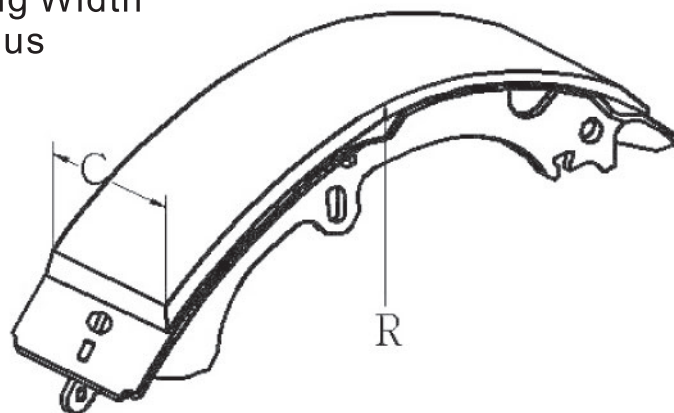C - Lining Width
R - Radius





APPLICATION DATA - INDEX

ACURA.....	1	LADA.....	127
ALFA ROMEO.....	3	LAND ROVER.....	128
AUDI.....	6	LEXUS.....	130
BMW.....	12	LINCOLN.....	133
BUICK.....	18	MAZDA.....	135
CADILLAC.....	21	MERCEDES BENZ.....	161
CHEVROLET.....	24	MINI.....	169
CHEVROLET TRUCK..	28	MITSUBISHI.....	170
CHRYSLER.....	33	NISSAN.....	206
CITROEN.....	36	OPEL.....	233
DAEWOO.....	40	PEUGEOT.....	239
DAIHATSU.....	43	PORSCHE.....	245
FIAT.....	54	RENAULT.....	247
FORD.....	59	SEAT.....	255
FORD TRUCK.....	68	SKODA.....	259
GMC TRUCK.....	71	SMART.....	261
HONDA.....	73	SSANGYONG.....	262
HYUNDAI.....	93	SUBARU.....	263
INFINITI.....	98	SUZUKI.....	272
ISUZU.....	101	TATA.....	287
JAGUAR.....	119	TOYOTA.....	288
JEEP.....	121	VOLKSWAGEN.....	344
KIA.....	123	VOLVO.....	354

CHEVROLET TRUCK

			
CHEVROLET TRUCK			
ASTRO VAN			
	91~02	MD8150M	
	02~05	MD8253M	MD8248M
4WD	89~91	MD8181M	MS8831
	91~02	MD8181M	
	03~05	MD8253M	MD8248M
AVALANCHE 1500 / 2500			
	02~	MD8252M	MD8248M
		MD8253M	MD8254M
	03~	MD8253M	MD8254M
			MD8248M
	04~	MD8253M	MD8254M
BLAZER			
	01~05	MD8287	MD8289M
COLORADO			
	04~	MD8311	
C-1500 / 2500			
C-1500	93~02	MD8181M	
C-1500 Suburban	94~99	MD8181M	
	00~02	MD8253M	MD8254M
	03~04	MD8253M	MD8254M
C-2500 Suburban	94~96	MD8181M	
	00~03	MD8252M	MD8253M
	04~	MD8252M	MD8253M
		MD8253M	
C-2500	11~	8523-D1411	MD8253M
C-3500			
SRW	99~00	7260-D370	
REAR DISC	99~00	7815-D380	7815-D380
DRW	99~00	MD8420	
	01~02	7815-D380	7815-D380
	11~	8523-D1411	8523-D1411
D4500 KODIAK			
	03~06	7914-D1010	7914-D1010
	07~	7636-D1032	7696-D1064

CHEVROLET TRUCK

			
DIH PB	08~09	7636-D1418	7969-D1054
	08~09	7636-D1418	7914-D1010
	10~	7636-D1418	
C5			
	02~	7636-D1032	
C5500 KODIAK			
	02~	7636-D1032	
	03~	7914-D1010	7914-D1010
	04~05	7914-D1010	7914-D1010
	06~	7914-D1010	7969-D1064
	07~	7636-D1032	7636-D1032
	08~	7636-D1418	7969-D1064
	09~	7636-D1418	7914-D1010
C6500 KODIAK			
	03~04	7914-D1010	7636-D1032
	05~08	7836-D1032	7636-D1032
	09~	7636-D1418	7914-D1010
	10~	7636-D1418	
C7500 KODIAK			
	03~08	7636-D1032	7636-D1032
	09~	7636-D1418	7636-D1032
COLORADO			
	04~08	7943-D1039	1548-S815
	09~10	7636-D1418	7636-D1032
EQUINOX			
	05~06	MD8204M-10	
	07~09	MD8491M	MD8492M
	10~	8536-D1421	MD8492M
EXPRESS			
Express 1500	02~	MD8181M	
Express 1500 Van	03~04	MD8253M	
	05~08	MD8253M	7881-D974
	09~11	8472-D1363	7881-D974
Express G1500 Van	99~01	MD8181M	
Express 2500 Van	03~05	MD8253M	
	06~07	MD8252M-10	

CHEVROLET TRUCK

			
	08~	MD8252M-10	7875-D974
Express G2500 Van	99~	MD8181M	
Express 3500 Van	03~06	MD8252M	
	07~	MD8252M-10	
	08~11	8454-D784	8523-D1411/7875-D974
Express 4500 Van	09~10	8454-D784	8523-D1411
G-1500	94~	MD8150M	
G-1500 Van	97~98	MD8181M	
G-2500	94~	MD8150M	
G-2500 Van	97~98	MD8181M	
K-BLAZER			
	90~91	MD8150M	
	92~94	MD8181M	
K-1500 / 2500			
K-1500	93~	MD8181M	
	94~00	MD8181M	
K-2500	94~00	MD8181M	
	11	8523-D1411	MD8253M
K-3500			
	99~00	7260-D370	
	11	8523-D1411	8523-D1411
SILVERADO			
1500	99~00	MD8253M	MD8248M
	01~02	MD8252M	MD8248M
		MD8253M	MD8253M
	03~04	MD8253M	MD8248M
	05~07	MD8531M	MD8248M
		MD8253M	MD8254M-10
	08~12	7997-D1363	8312-D1194
1500 HD	02~07	MD8252M	MD8253M
		MD8253M	MD8254M
1500 Hybrid, 1500 2WD, 1500 4WD, 2500	06~	MD8253M	
1500 4W Steer	03~	MD8253M	MD8254M
1500 4DR Cab	03~	MD8253M	MD8253M
2500	99~01	MD8252M	MD8253M
	02~	MD8252M	MD8253M
		MD8253M	
	03~04	MD8252M	MD8253M

CHEVROLET TRUCK

			
2500 HD	01~	MD8252M	MD8253M
	02~	MD8252M	MD8253M
		MD8253M	
	04~10	8454-D784	MD8253M
	11	8523-D1411	8523-D1411
	12	8523-D1565	8523-D1411
3500	02~03	MD8252M	
	04~	MD8252M	MD8253M
3500	04~06	MD8252M	
HD 3500	01~02	MD8252M	
	07~10	8454-D784	7788-D909/MD8253M
	11	8523-D1411	8523-D1411
	12	8523-D1565	8523-D1411
Silverado SS	04~	MD8253M	MD8284M
Silverado SS	05~	MD8253M	
SSR			
	04~	MD8255M	MD8306M
	06~	8282-D1169	MD8306M
SUBURBAN			
1500	05~	MD8253M	
1500	06~	MD8253M	
1500	08~	MD8531M	8312-D1194
1500	08~12	8472-D1363	8312-D1194
2500	04~	MD8253M	MD8253
2500	05~	MD8253M	MD8253
2500	06~	MD8252M	MD8253
2500	08~12	8454-D784	MD8253M
T-10			
	02~	MD8255	MD8306M
	03~	MD8287	MD8289M
	04~	MD8287	MD8289M
T6500, T7500			
	04~08	7636-D1032	7636-D1032
	09~10	7636-D1418	7636-D1417

CHEVROLET TRUCK

[illegible]

			
FORD TRUCK			
ESCAPE			
	01~06	MD8188	
	06~07	MD8507	MD8508
	08~12	MD8507	
Hybrid	08~	MD8507-10	MD8508
Hybrid	09~12	MD8507-10	
EXCURSION			
	00~05	MD8256	MD8424
EXPEDITION			
	97~98	MD8155M	MD8156
	99~02	MD8155M	MD8156-10
	03~06	MD8312M	MD8313M
EXPLORER			
	02~03	MD8204	
	04~	MD8204	
	05~	MD8204	
E-150			
	90~93	MD8419	
	95~96	MD8203	
	97~98	MD8203	
	00~03	MD8203	
Econoline	03~	MD8203	
E-250			
	95~97	MD8423	
	98~	MD8423	
	99~00	MD8423	
	01~	MD8423	
	02~03	MD8423	
Econoline	04~06	MD8423	
E-350			
	93~94	MD8423	
	95~98	MD8423	
	04~06	MD8423	
Econoline	04~06	MD8423	


			
E-450 ECONOLINE			
	03~05	MD8423	
	06~	MD8423	
E-550 ECONOLINE			
	02~06	MD8257	
E SUPER DUTY			
	00~	MD8423	
F-150			
	90~93	MD8419	
	95~96	MD8203	
	96~	MD8187M	
	97~	MD8187M	
	98~	MD8187M	
	99~	MD8187M	MD8156
	99~00	MD8187M	MD8156-10
	01~02	MD8187M/MD8155M	MD8156-10
	03~	MD8187M	MD8156-10
	04~	MD8187M/MD8428	MD8156-10/MD8427
	05~	MD8428	MD8427
	06~	MD8428	MD8427
7700GVW	04~	MD8155M	MD8156-10
Lightning, w/7 Lugs	03~	MD8155M	MD8156-10
F-250			
	95~96	MD8423	
	97~	MD8155M	
	98~	MD8155M	MD8156
	99~	MD8155M/MD8423	MD8156/MD8156-10
	00~	MD8256	MD8424
	01~	MD8256	MD8424
	03~	MD8256/MD8257	MD8424
	04~	MD8256	MD8424
Super Duty	98~99	MD8256	MD8424
Super Duty	00~04	MD8256	MD8424
F-350			
	95~97	MD8423	
	98~00	MD8257	MD8424

FORD TRUCK

[illegible]

			
GMC TRUCK			
CANYON	04~08	MD8311	
DENALI			
	00~	MD8253M	MD8254M
ENVOY			
	99~01	MD8287M	MD8289M
	02~04	MD8255M	MD8306M
	06~		MD8306M
Envoy XUV	04~	MD8255M	MD8306M
JIMMY			
	97~	MD8287	MD8289
	01~05	MD8287	MD8289
	03~05	MD8287	MD8289
SAFARI VAN			
	87~90	MD8150M	
	91~02	MD8150M	
	03~04	MD8253M	MD8287
	03~05	MD8253M	MD8284
4WD	91~02	MD8181M	
SAVANA			
1500	02~	MD8181M	
	05~06	MD8253M	
G 1500	97~01	MD8181M	
Van 1500	03~04	MD8253M	
Van 2500	03~04	MD8253M	
2500	05~	MD8253M	
	06~07	MD8252M	
	08~	MD8252M-10	
G 2500	97~99	MD8181M	
	00~	MD8181M	
SONOMA			
	98~01	MD8287	MD8289
	02~	MD8255M	MD8306
S 15	03~	MD8287	MD8289
S 15 4×4	03~	MD8287	MD8289
4WD	00~	MD8287	MD8289










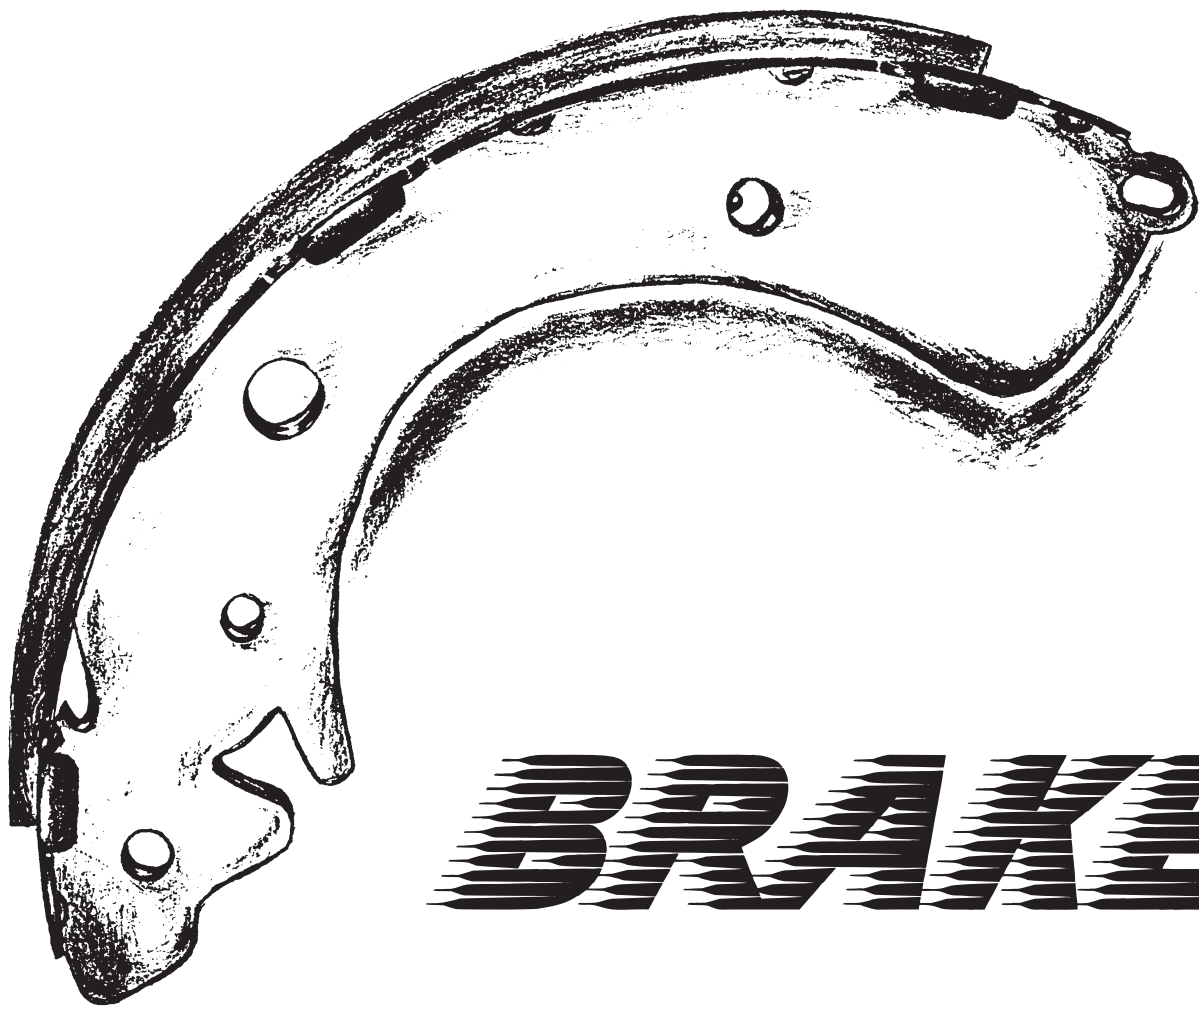
MD8253M











BRAKE

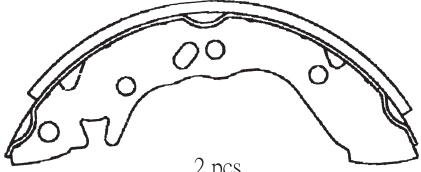
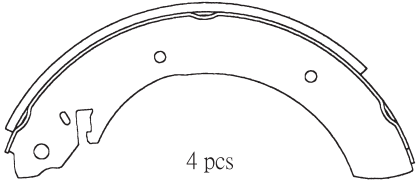
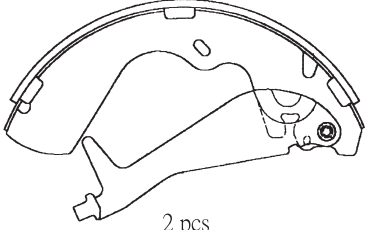
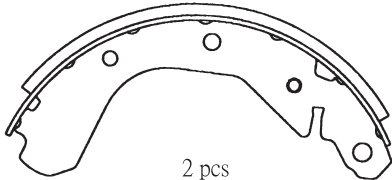
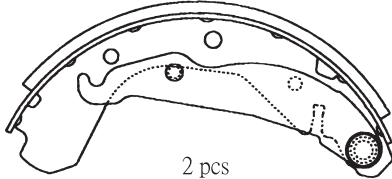
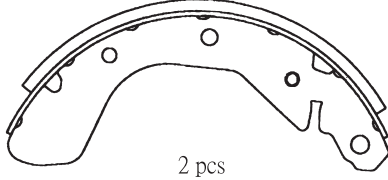
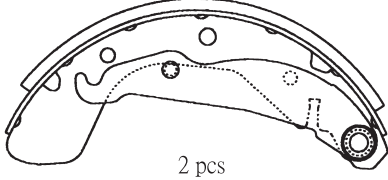
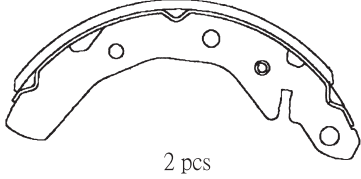
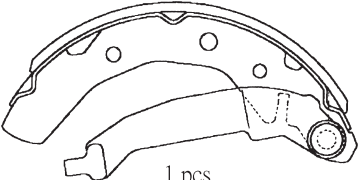
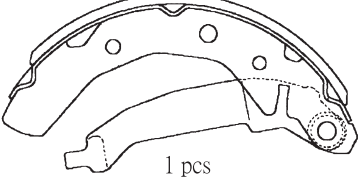
SHOE



MS8801 (Rear) HYUNDAI Accent,Excel,Pony  2 pcs	MS8804 (Front) SSANGYONG Korando HYUNDAI Sonata  4 pcs
 89.6  35 FMSI	MS8805 (Rear) HYUNDAI Starex,Gallopel II  2 pcs
MS8802 (Rear) OPEL Ascona,Kadett  2 pcs  2 pcs	 134.4  52 FMSI
MS8803 (Rear) DAEWOO Aranos,Lanos,Nexia OPEL Astra,Corsa  2 pcs  2 pcs	MS8806 (Rear) DAEWOO Matiz,Tico  2 pcs  1 pcs  1 pcs
 100  45 FMSI 1508-S740	 90  30 FMSI

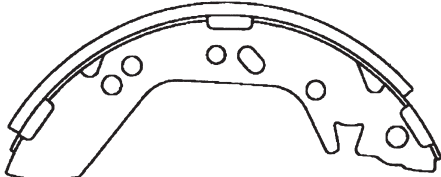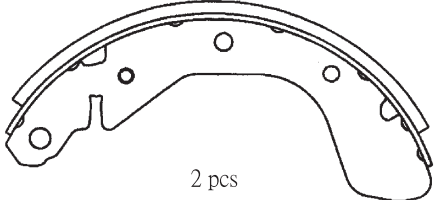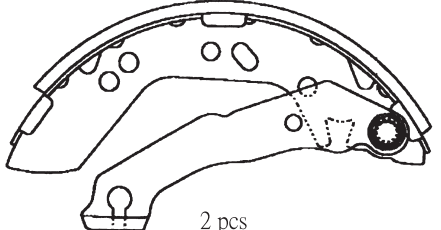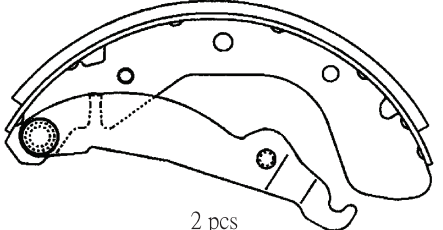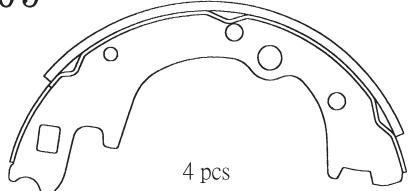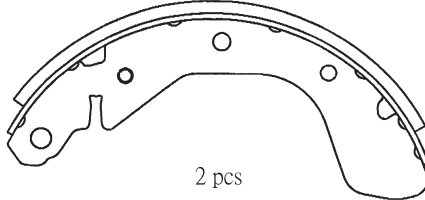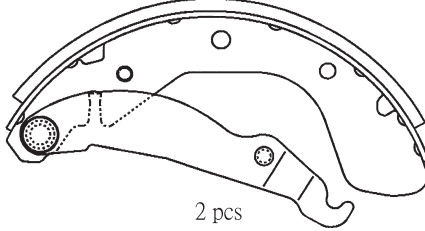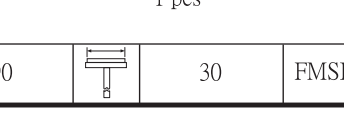MS8808 (Rear)		HYUNDAI Accent		MS8810A (Rear)		CHEVROLET Corsa					
		2 pcs				2 pcs					
		2 pcs				2 pcs					
	90		35	FMSI	1451-S749		100		28	FMSI	
MS8809 (Front)		HYUNDAI New Porter		MS8811 (Rear)		HYUNDAI Excel,Pony,S-Coupe					
		4 pcs				2 pcs					
	110		45	FMSI							
MS8810 (Rear)		OPEL Astra,Corsa				2 pcs					
		2 pcs				1 pcs					
											
		1 pcs				1 pcs					
	100		28	FMSI			90		30	FMSI	

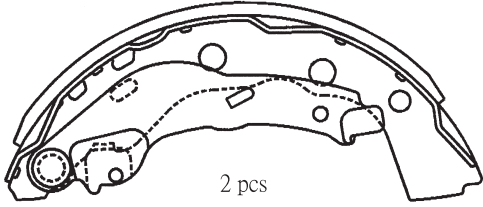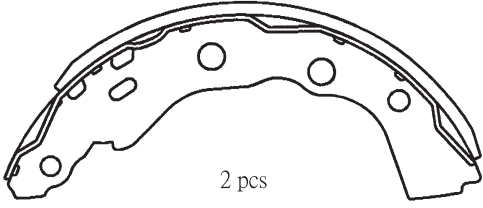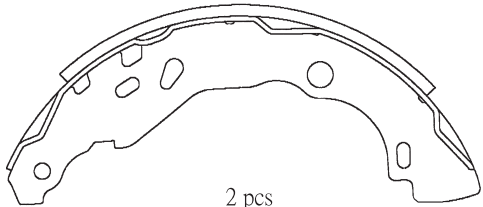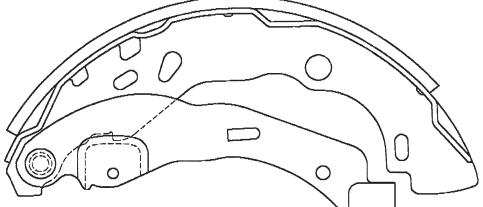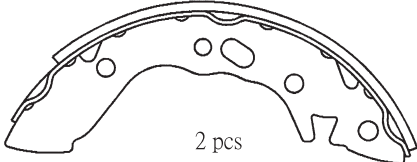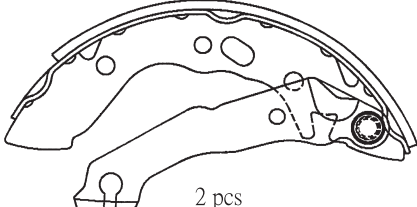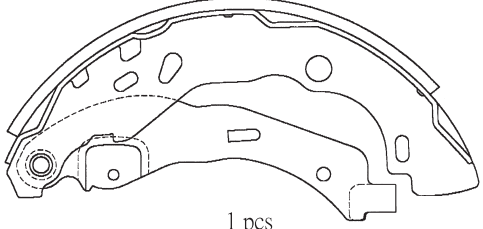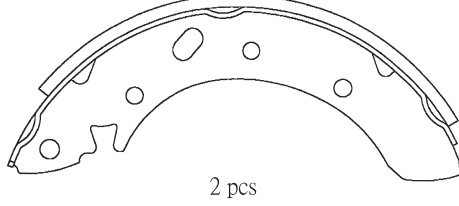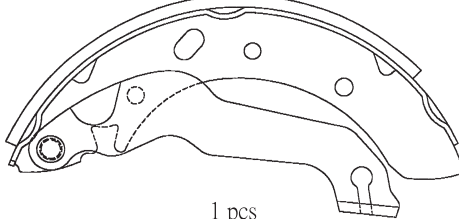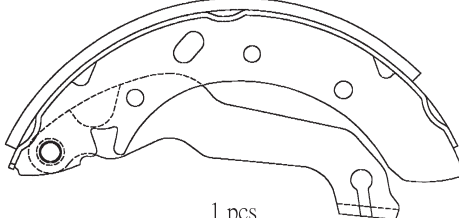1.MS8807 = MS3413

MS8812 (Rear)  2 pcs  2 pcs	MS8814 (Rear)  2 pcs  1 pcs
MS8813 (Rear)  2 pcs  2 pcs	 1 pcs
	MS8815 (Rear)  2 pcs  1 pcs  1 pcs

OTHERS





MS8816 (Rear)		HYUNDAI Elantra,Tiburon			
2 pcs					
1 pcs					
1 pcs					
	101.5		37	FMSI	1495-S715

MS8816A (Rear)		HYUNDAI Elantra,Tiburon			
2 pcs					
1 pcs					
1 pcs					
	101.5		37	FMSI	1495-S715

MS8817		HYUNDAI Accent			
2 pcs					
2 pcs					
	90		30	FMSI	

MS8817A		HYUNDAI Accent ,Excel ,Pony			
2 pcs					
2 pcs					
	89.7		30	FMSI	

MS8818		HONDA City			
4 pcs					
	89.5		30	FMSI	

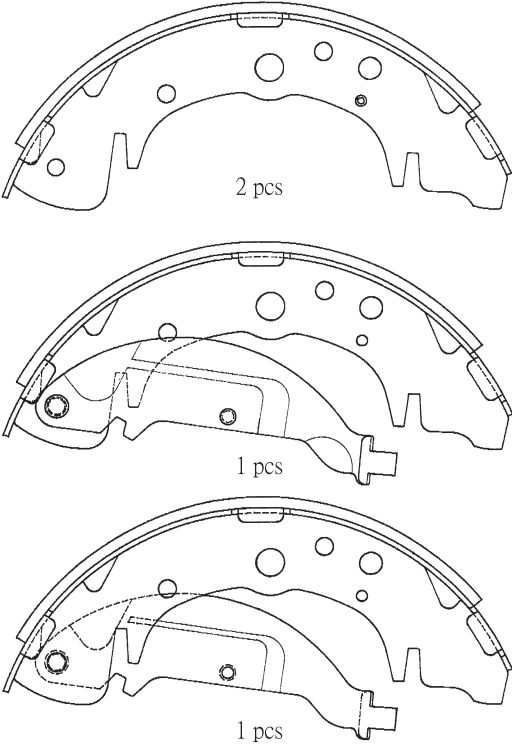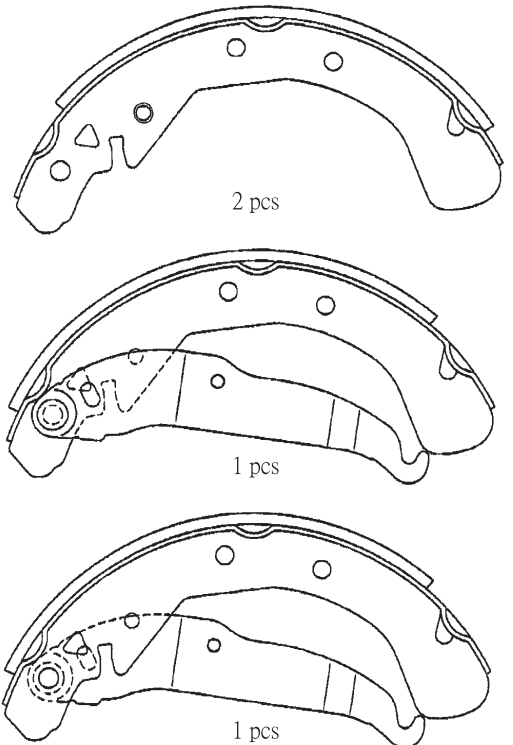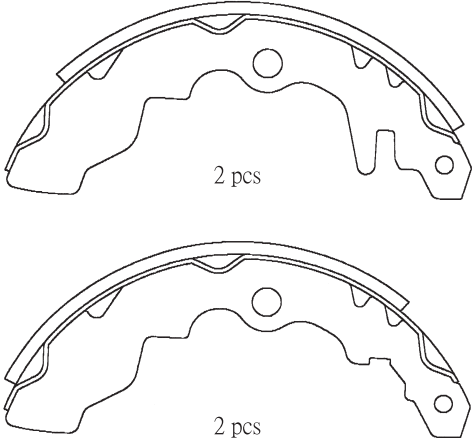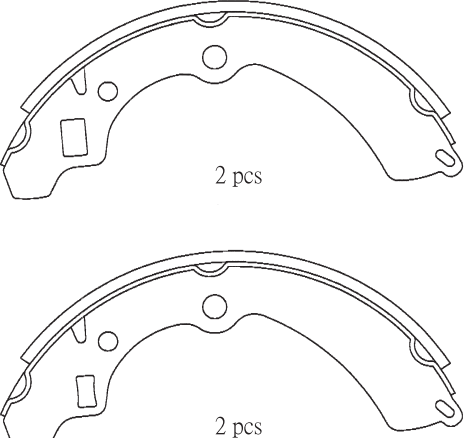
MS8819 (Rear)  2 pcs 1 pcs 1 pcs	MS8821 (Rear)  2 pcs 1 pcs 1 pcs
R 126.9 55 FMSI 1532-S789	R 114.3 40 FMSI
MS8820 (Rear)  2 pcs 2 pcs	MS8821A (Rear)  2 pcs 2 pcs
R 89.6 30 FMSI	R 110 39 FMSI

1. MS8821A = MS9921


MS8821B

(Rear)

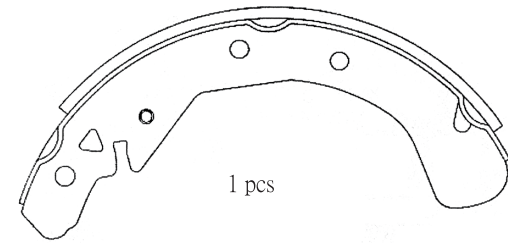
OPEL ASTRA (G. M.)




1 pcs

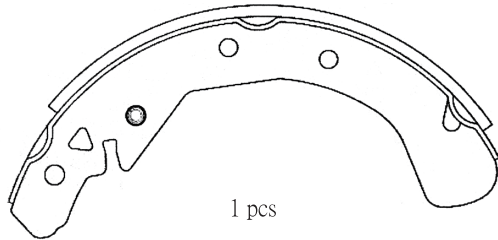

1 pcs

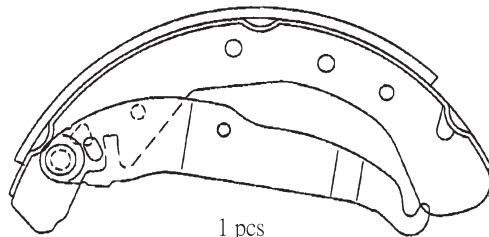

1 pcs

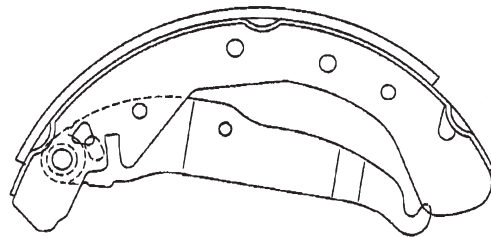

1 pcs



114.3




40

FMSI


MS8822

(Rear)

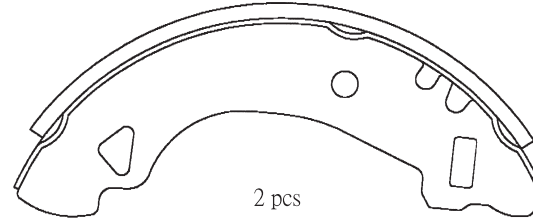
FIAT Panda, Uno



2 pcs

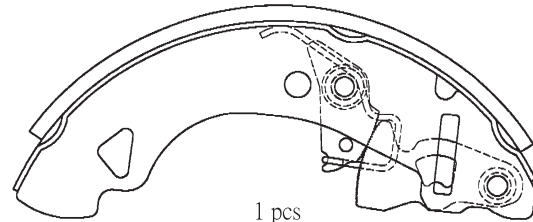

1 pcs

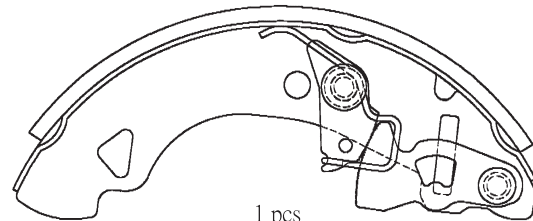

1 pcs



92




30

FMSI

MS8823

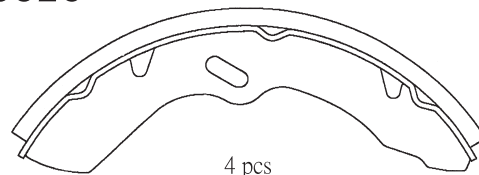HYUNDAI



4 pcs



159




75

FMSI

MS8824

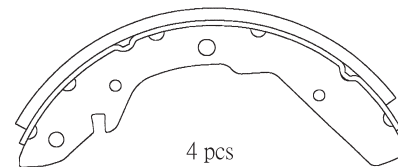V/W Transporter/Caravelle



4 pcs



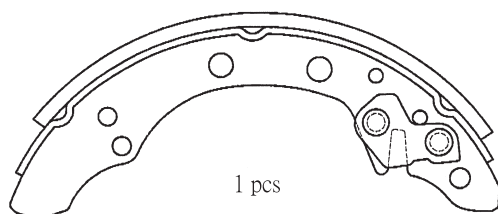
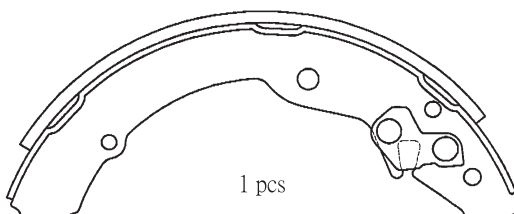
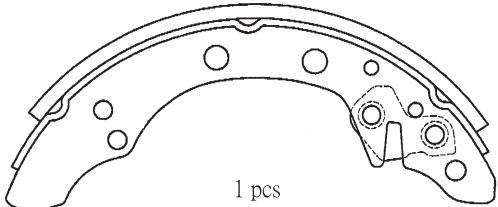
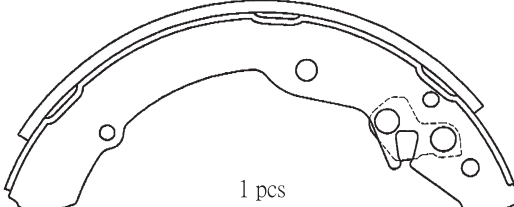
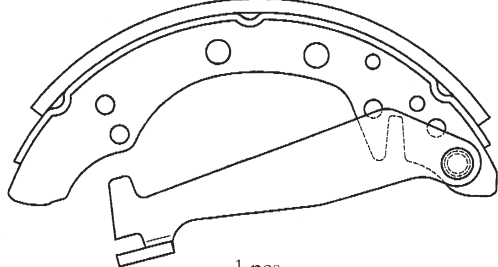
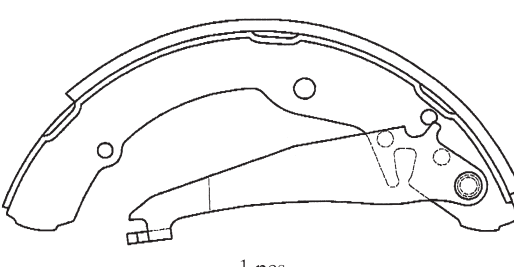
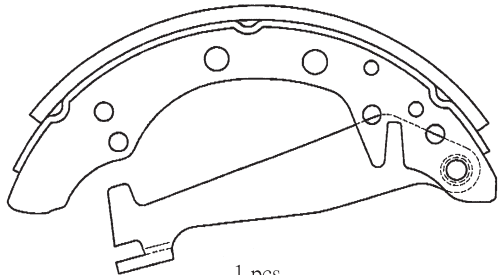
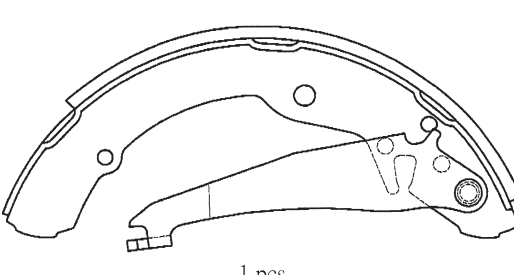
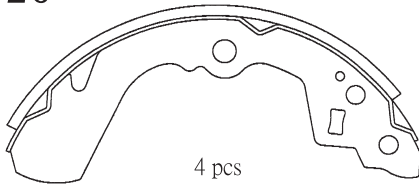
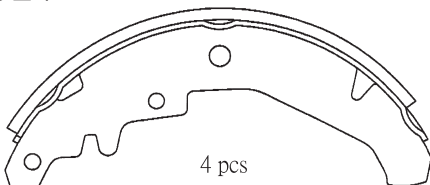
126





















55

FMSI









OTHERS












MS8825 (Rear)		V/W Golf(III)/Vento,Lupo,Polo(III) AUDI 80,A2				MS8828 (Rear)		SKODA Octavia V/W Caddy									
		1 pcs						1 pcs									
		1 pcs						1 pcs									
		1 pcs						1 pcs									
		1 pcs						1 pcs									
	100		39	FMSI	1450-S662		115		30	FMSI							
MS8826		SUZUKI 1000															
		4 pcs															
	99.3		30	FMSI													
MS8827		FIAT Palio,Siena															
		4 pcs															
	93		28	FMSI													


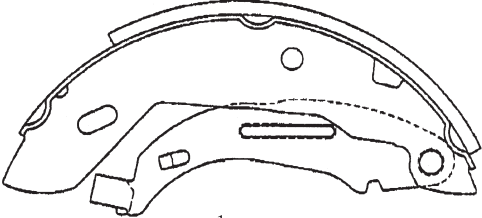
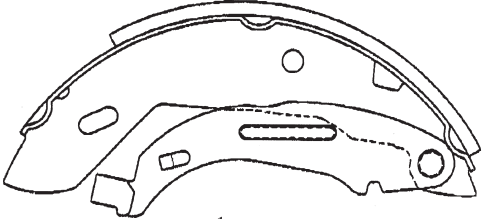
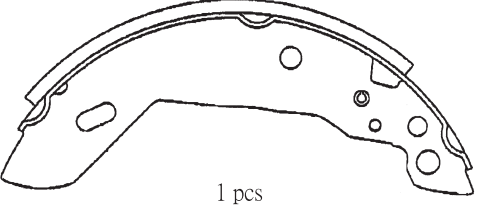
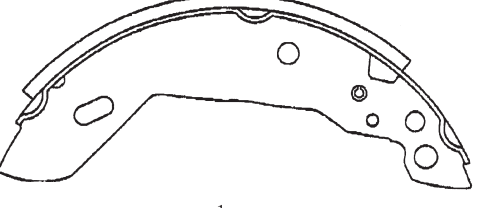
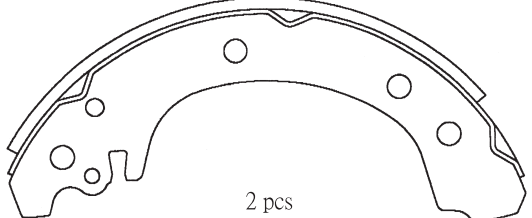
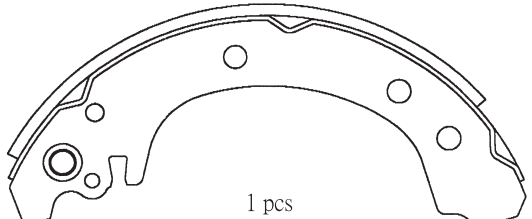
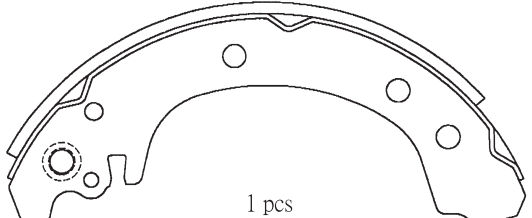
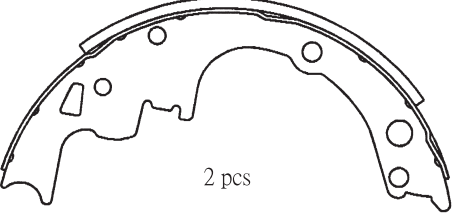
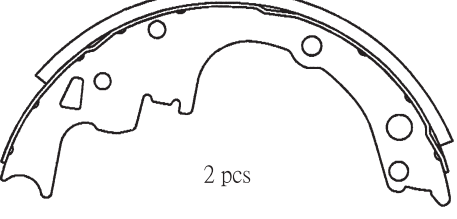
MS8829 FIAT Uno Petrol,Diesel Girling Type  1 pcs  1 pcs  1 pcs  1 pcs	MS8830 (Rear) TOYOTA Corolla  2 pcs  1 pcs  1 pcs
 91.5  29 FMSI	MS8831 (Rear) CHEVROLET TRUCK Astro Van(4WD), S-10/T-10 CHEVROLET Camaro  2 pcs  2 pcs
	 120.4 121.8  50 FMSI 2117ATT-514

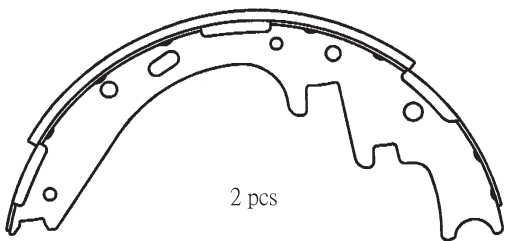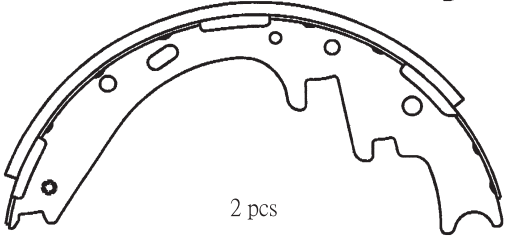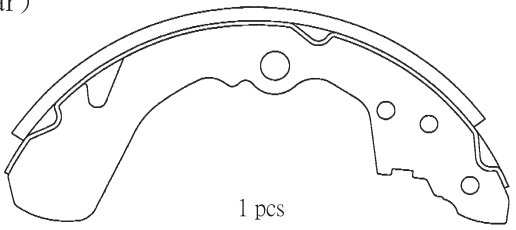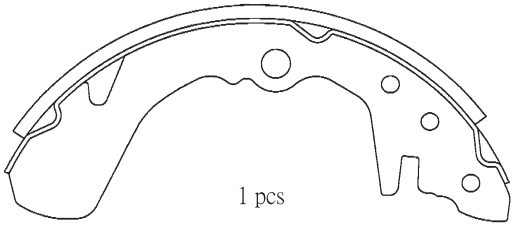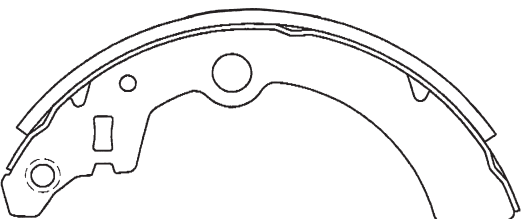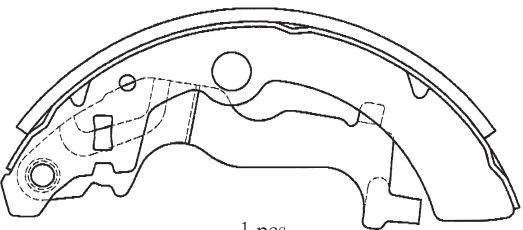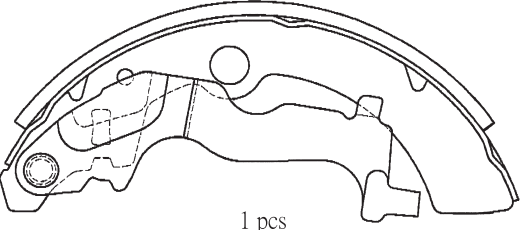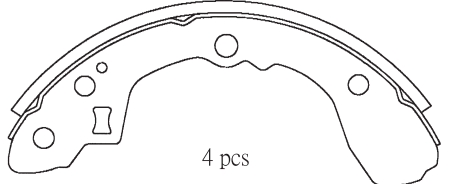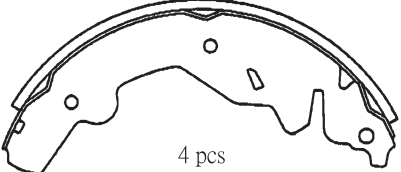MS8832 FORD TRUCK E-15,F-150  2 pcs  2 pcs	MS8834 MARUTI 1000 (Rear)  1 pcs  1 pcs
R 140 141.5 57 FMSI 2182TT-S723	R 100 30 FMSI
MS8833 Alto, Wagon  2 pcs  1 pcs  1 pcs	MS8836 KIA Mentor, Sephia, Shuma, Spectra (Rear)  4 pcs R 100 35 FMSI 1480-S697 MS8837 KIA Sportage  4 pcs R 125 55 FMSI
R 90 25 FMSI	

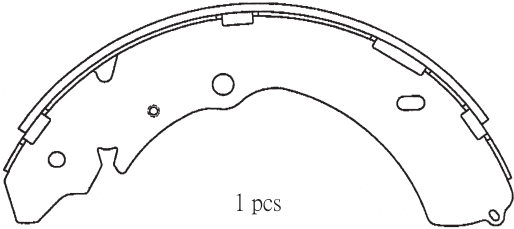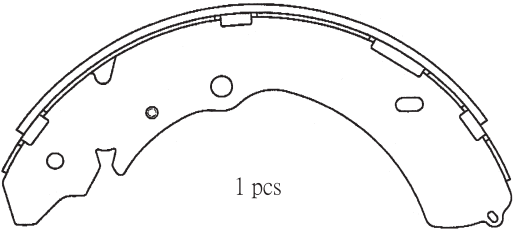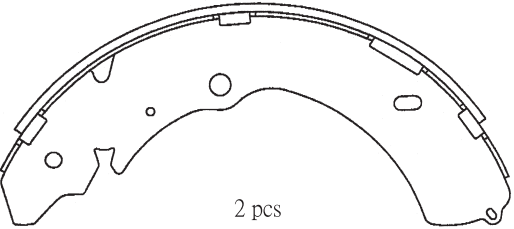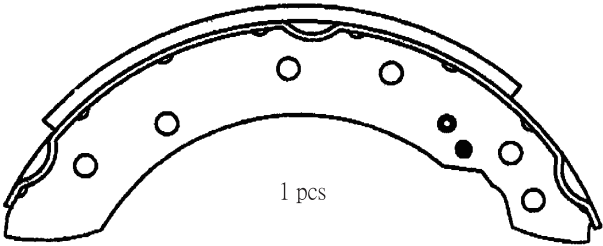
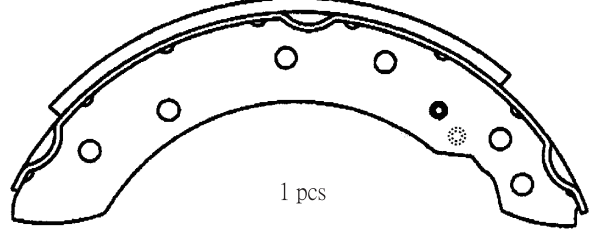
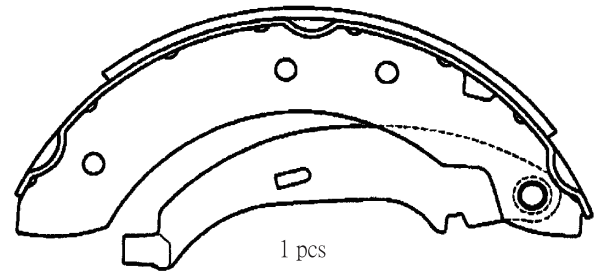
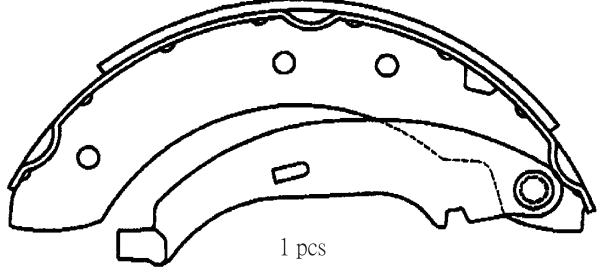
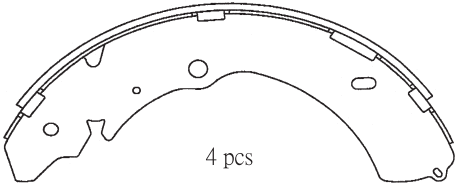
1.MS8833 = MS9959A
2.MS8835 = MS3416

MS8838 ISUZU D-MAX  1 pcs  1 pcs  2 pcs  147  45 FMSI	MS8839 NISSAN Platina  1 pcs  1 pcs  1 pcs  1 pcs  101.3  36 FMSI
MS8838A  4 pcs  147  45 FMSI	

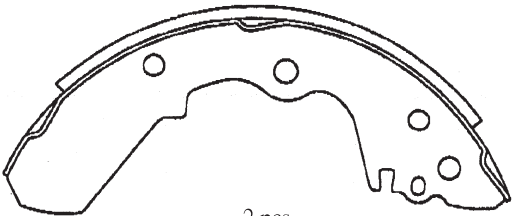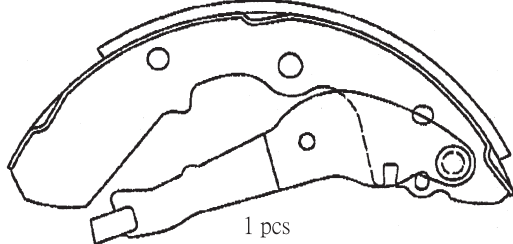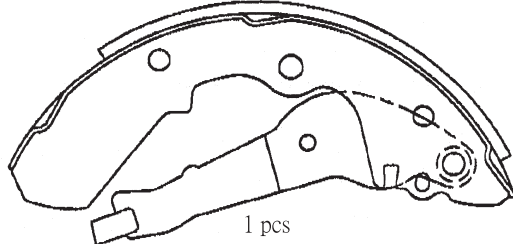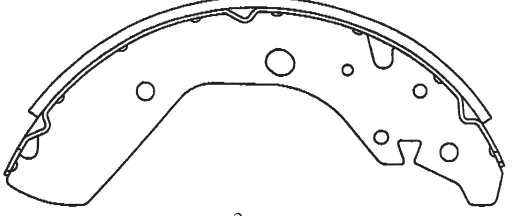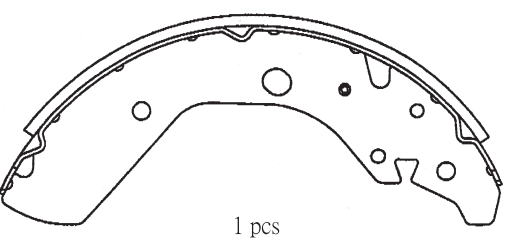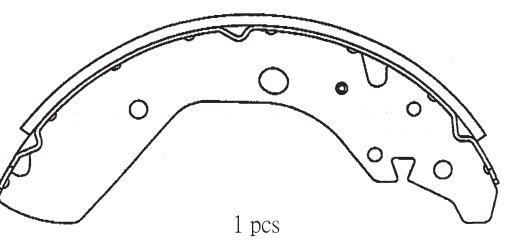
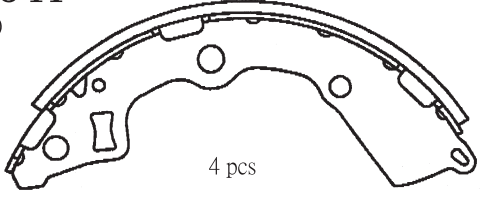
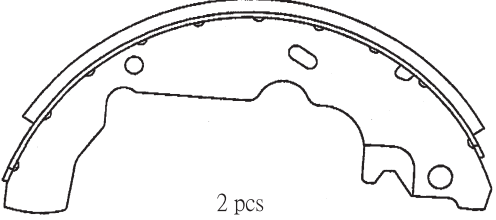
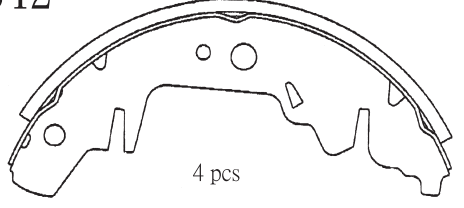
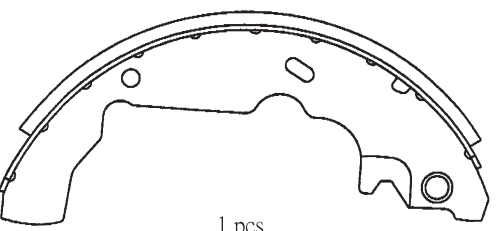
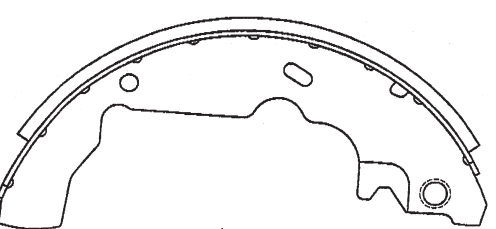
MS8840 CHEV TAVERA  2 pcs  1 pcs  1 pcs	MS8843 HONDA Odyssey (Rear)  2 pcs  1 pcs  1 pcs
R 127  50 FMSI	R 127  44.5 FMSI 1512-S744
MS8841 KIA Picanto (Rear)  4 pcs	MS8844 TOYOTA Sienna (Rear)  2 pcs
R 90  30 FMSI	
MS8842 KIA Carnival (Rear)  4 pcs	 1 pcs  1 pcs
	R 124.3  45 FMSI 1500-S729

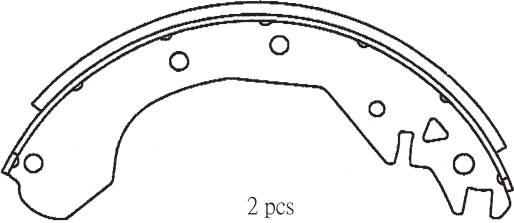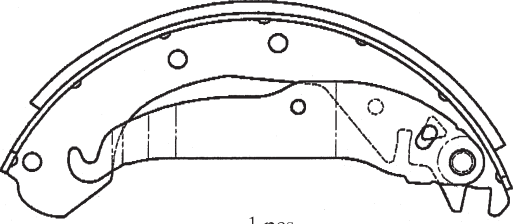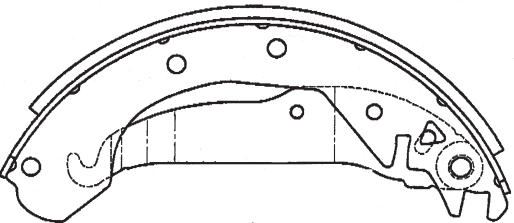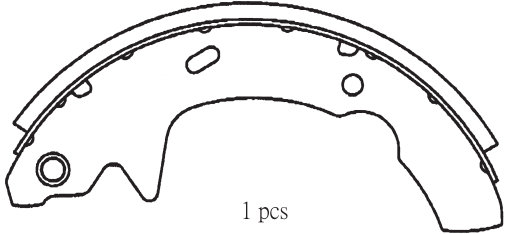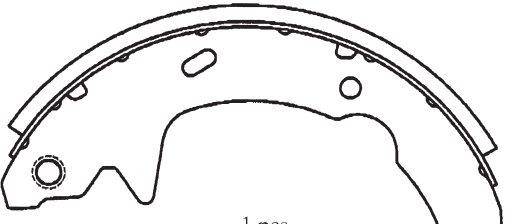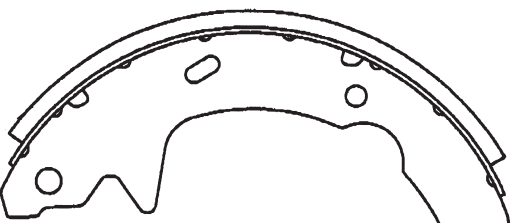
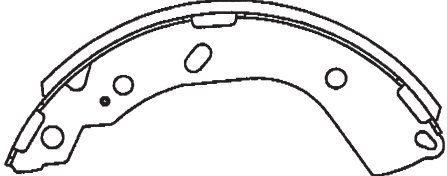
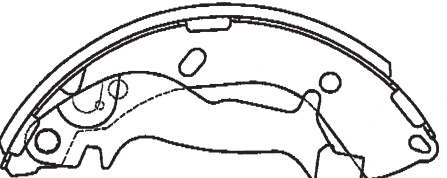
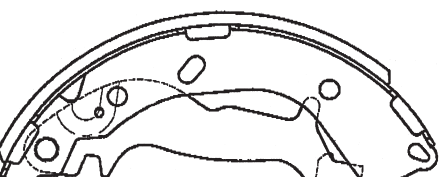
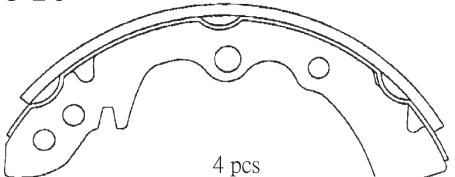
MS8845 (Rear)  2 pcs  1 pcs  1 pcs	OPEL Kadett					MS8848 (Rear)  1 pcs  1 pcs  2 pcs	FORD Taurus				
	114.3		48.5	FMSI			112.5		38	FMSI	1395-S599
MS8847 (Rear)  2 pcs  1 pcs  1 pcs	HYUNDAI Getz					MS8849  4 pcs					
	90		30	FMSI			119.5		39.6	FMSI	

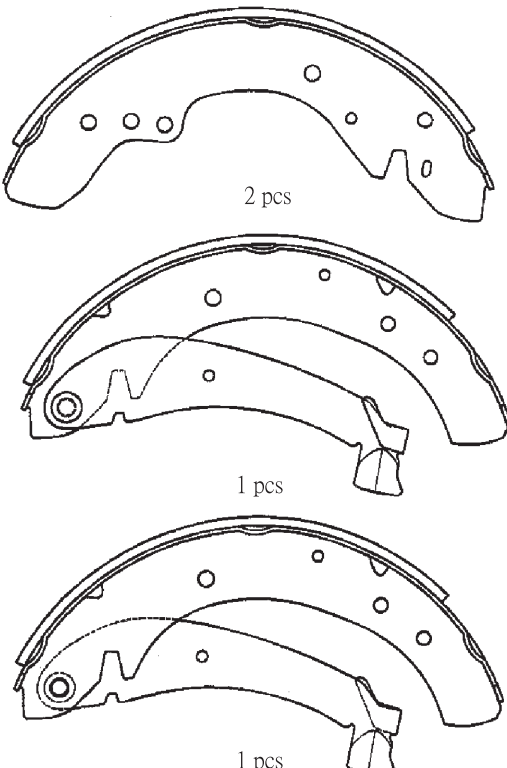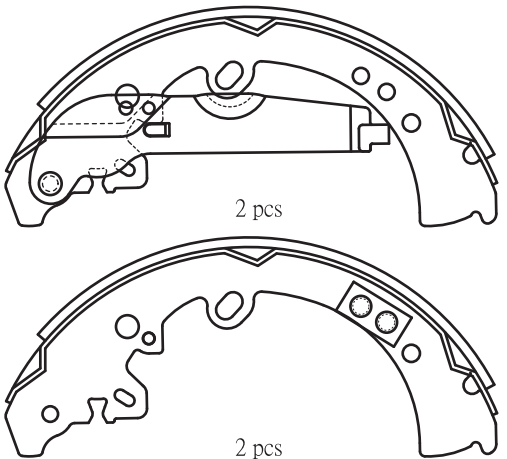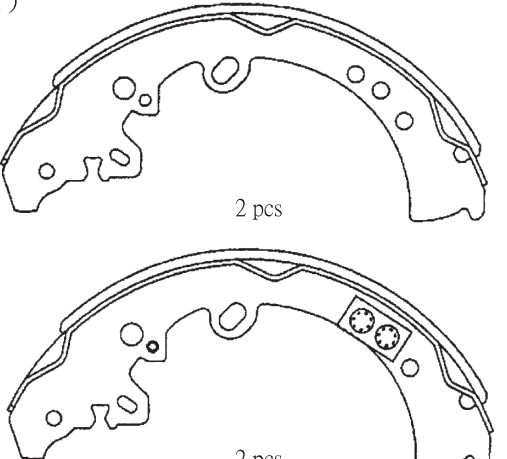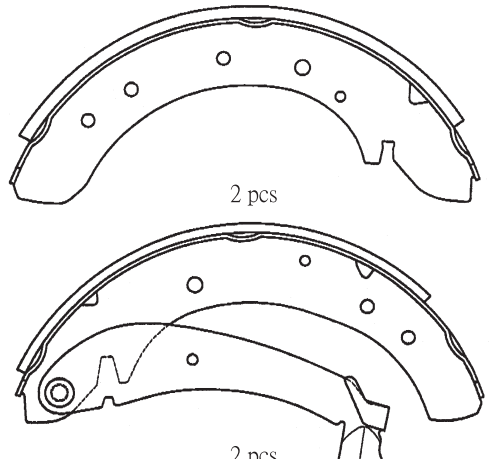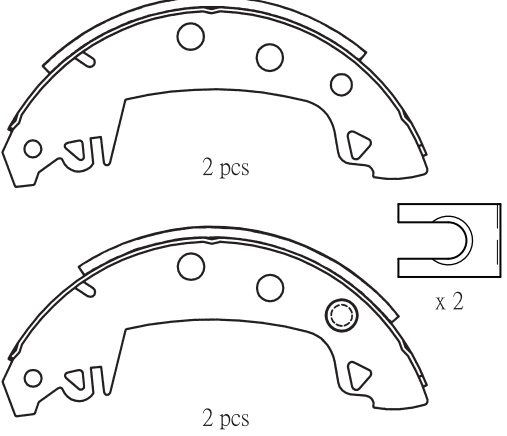1.MS8846 = MS2378






MS8851 (Rear)  2 pcs 1 pcs 1 pcs	MS8853 (Rear)  2 pcs 2 pcs  2 pcs 2 pcs	PEUGEOT Boxer(230) CITROEN Jumper FIAT Ducato TOYOTA HI-LUX(4X4) Fortuner(4X4) 147.5 50 FMSI 04495-OK020 147.5 50 FMSI
MS8852 (Rear)  2 pcs 2 pcs	MS8854 (Rear)  2 pcs 2 pcs x 2	CITROEN Jumper (18) FIAT Ducato(18)) 127 56 FMSI 127 56 FMSI 114.3 39 FMSI


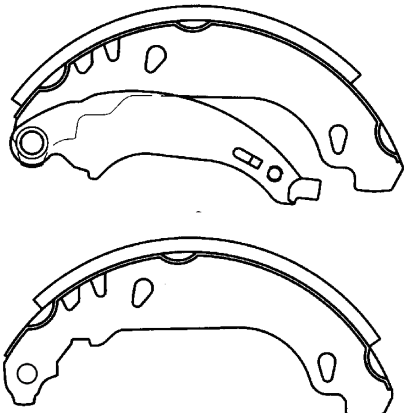
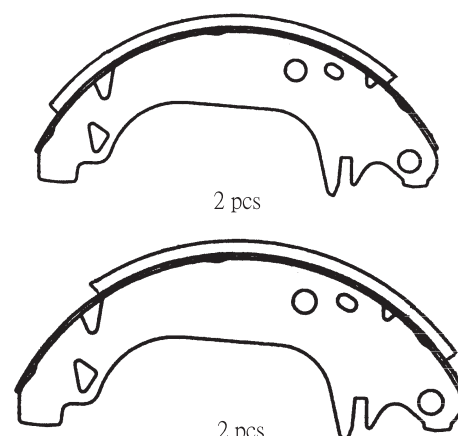
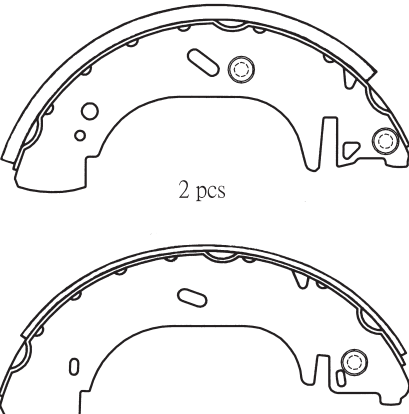
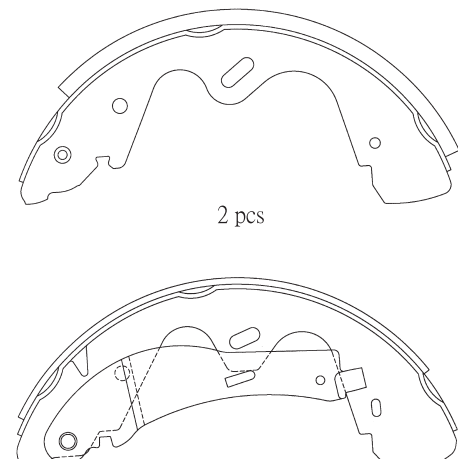
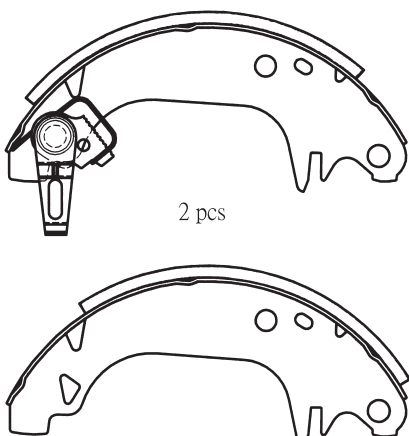
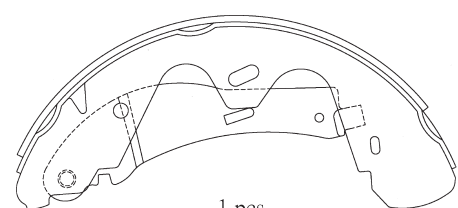
1.MS8850 = MS6600
2.MS8853A= MS2395

MS8855 (Rear)		RENAULT Clio II 1.2i/1.4i/1.9D		MS8857A (Rear)	
				2 pcs	
2 pcs		2 pcs		2 pcs	
	90		39	FMSI	
MS8856 (Rear)		FORD Transit 130,150,160,190 RENAULT Master II OPEL Movano		MS8858 (Rear)	
				2 pcs	
2 pcs		2 pcs		1 pcs	
2 pcs		1 pcs		1 pcs	
	140		65	FMSI	
MS8857 (Rear)		RENAULT R-5,R-9,R-11 PEUGEOT 309		MS8859 (Rear)	
				2 pcs	
2 pcs		2 pcs		1 pcs	
2 pcs		1 pcs		1 pcs	
	90		42	FMSI	
				FMSI	
				HYUNDAI Accent ERA	

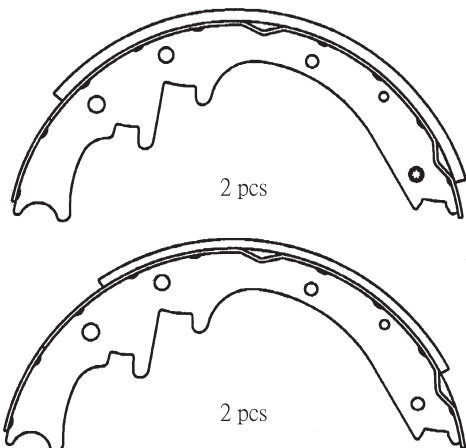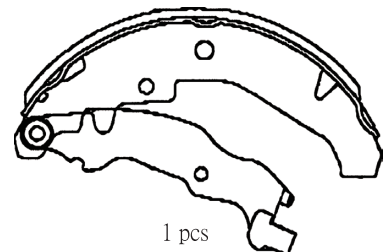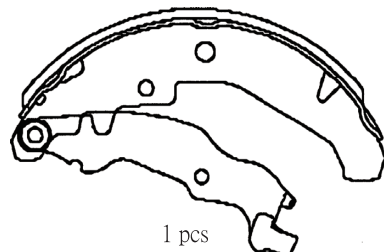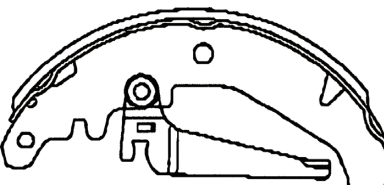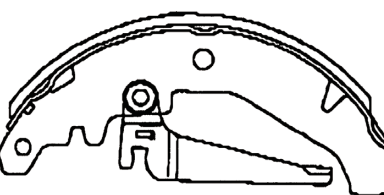MS8860 (Rear)  2 pcs 2 pcs	MS8863 (Rear)  1 pcs  1 pcs  1 pcs  1 pcs
 127  44.5 FMSI 2174TT-S670	  FMSI
MS8861 (Rear) 	MS8864 (Rear)
  FMSI	
MS8862 (Rear) PEUGEOT Boxer Bus/Van/Flatbed-chassis CITROEN Jumper FIAT Ducato	
  FMSI	 93  30 FMSI

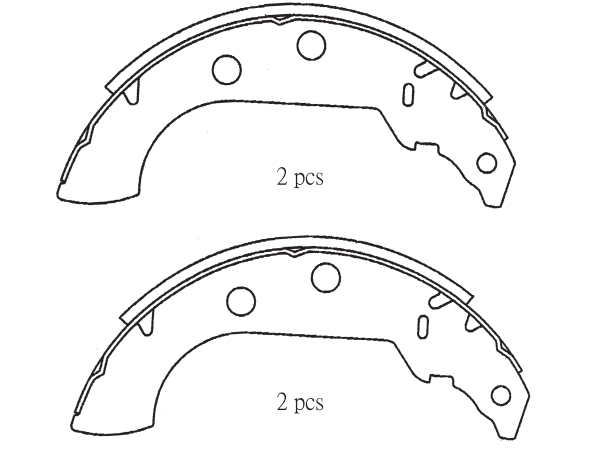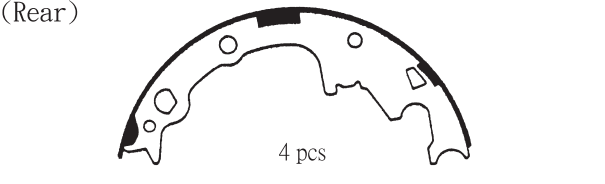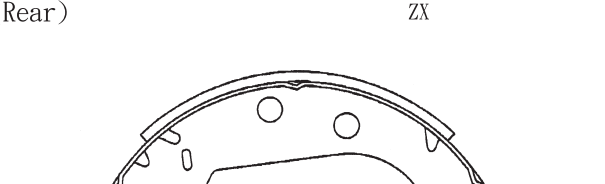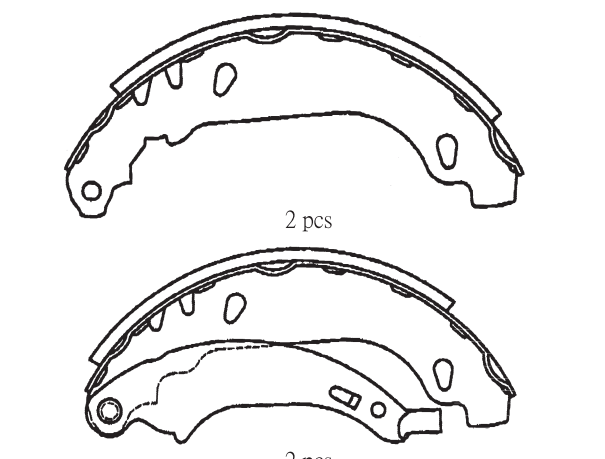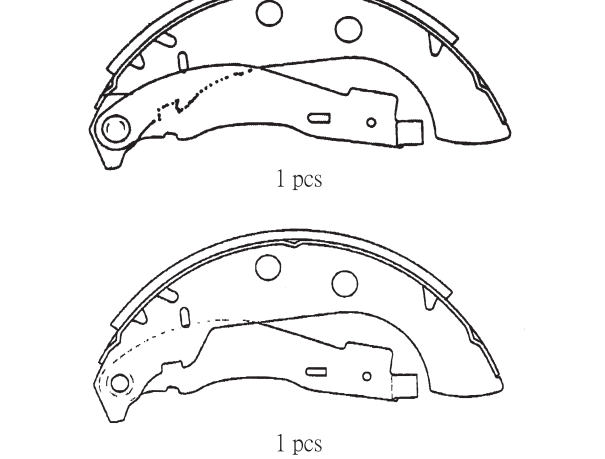OTHERS

MS8865 (Rear)		TOYOTA Yaris(EUR)		MS8868 (Rear)		PEUGEOT 306,405,306 Cabrio CITROEN Xsara Break,ZX	
				2 pcs		2 pcs	
			FMSI		114.3		41 FMSI
MS8866 (Rear)		JEEP Cherokee/Wrangler		MS8868A (Rear)		CITROEN Xsara Break PEUGEOT 306 ZX	
				4 pcs		2 pcs	
	114.3		63.5 FMSI	2176T-538			41 FMSI
MS8867 (Rear)		PEUGEOT 206					
2 pcs		2 pcs		1 pcs		1 pcs	
	90		30 FMSI		113.5		41 FMSI
				2 pcs		1 pcs	
			FMSI				FMSI

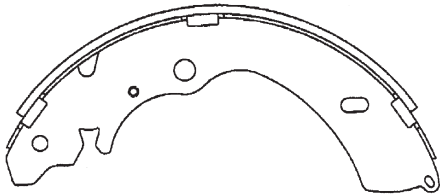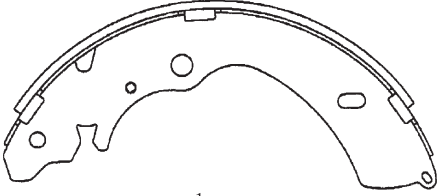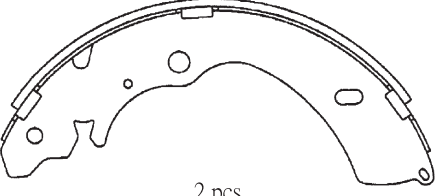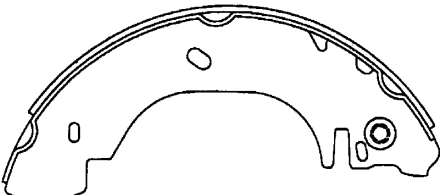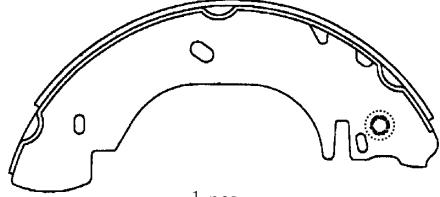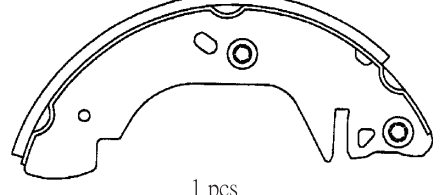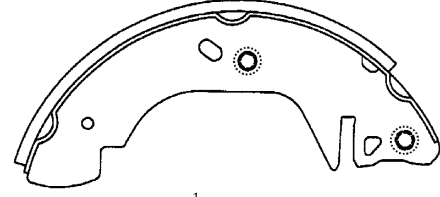
MS8869 ISUZU D-MAX (For EGYPT) (Rear)  1 pcs  1 pcs  2 pcs R 126  50 FMSI	MS8870 FORD Transit 80/100/120 (Rear)  1 pcs  1 pcs  1 pcs  1 pcs R 127  51 FMSI

1.MS8869 = MS4470


MS8871

(Rear)

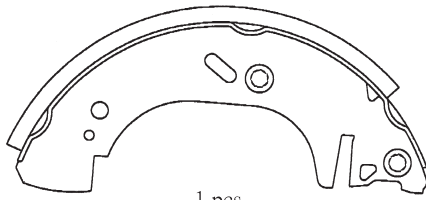
FORD Tourneo, Transit 100/150/190
RENAULT Master T28/T33/T35/T39
OPEL Movano




1 pcs

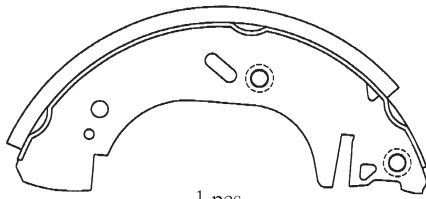

1 pcs

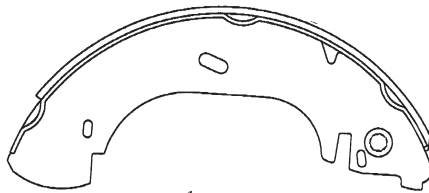

1 pcs

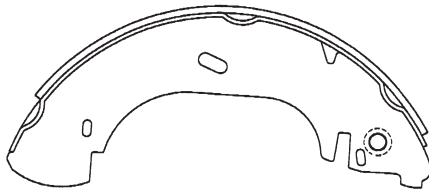


1 pcs

R	140		63	FMSI	
---	-----	--	----	------	--


MS8872

(Rear)

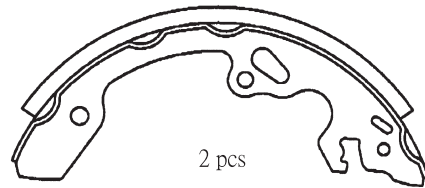
FORD Focus, Focus Estate/Wagon/Van



2 pcs

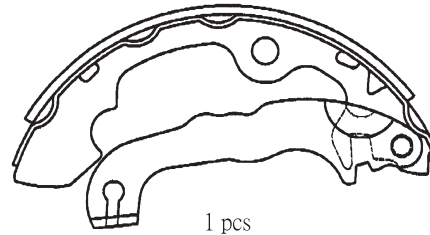

1 pcs

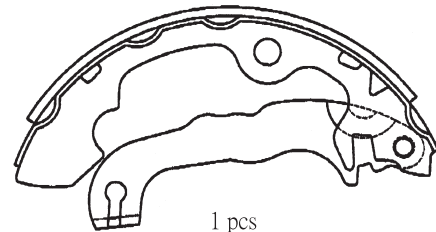


1 pcs

R	100		36	FMSI	
---	-----	--	----	------	--


MS8873

(Rear)

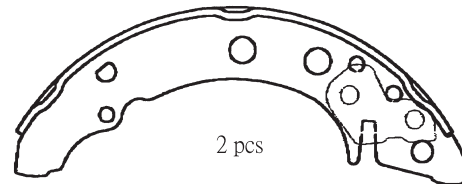V/W Derby, Golf/Jetta/Lupo/Passat
PEUGEOT Arosa, Cordoba I, Ibiza II
AUDI 80















2 pcs

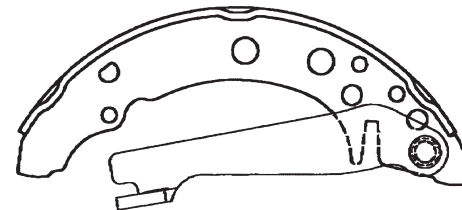







2 pcs

R	90		31	FMSI	
---	----	--	----	------	--

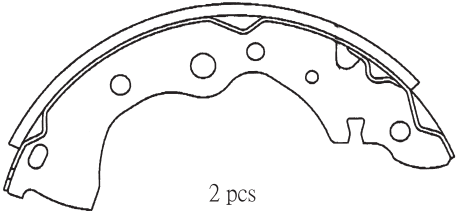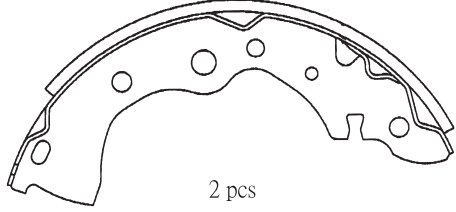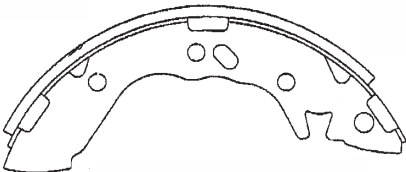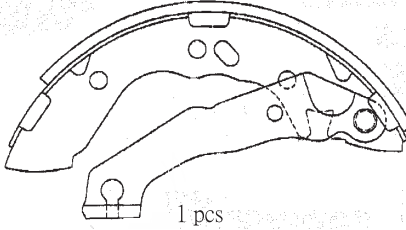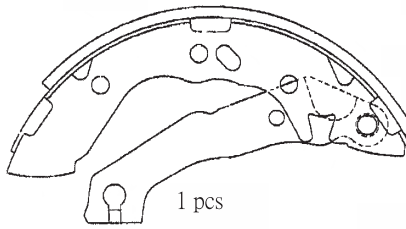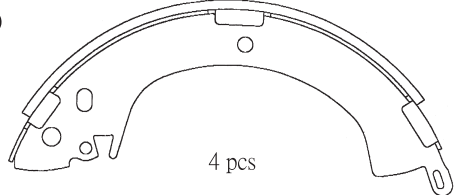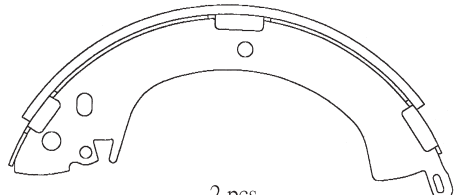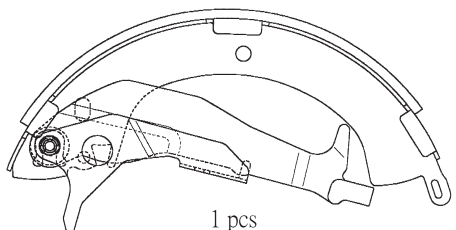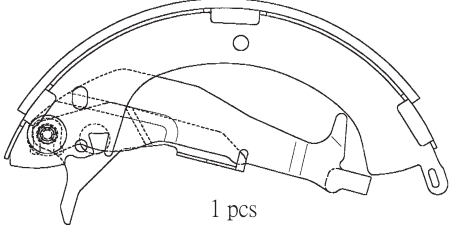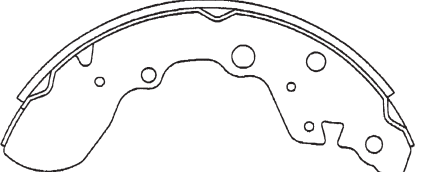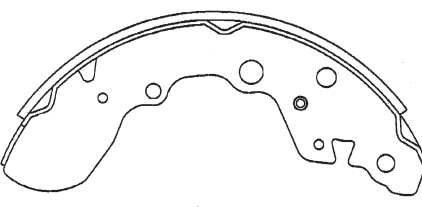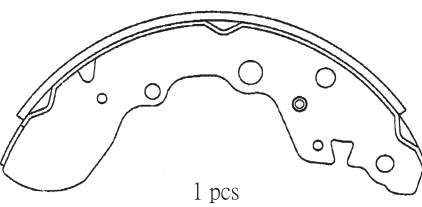OTHERS

MS8874 (Rear)  2 pcs  2 pcs  101.6  35 FMSI 1525-S779	MS8876 (Rear)  2 pcs  1 pcs  1 pcs  89.3  35 FMSI
MS8875 (Rear)  4 pcs  126.8  50 FMSI	 89.3  35 FMSI
MS8875A (Rear)  2 pcs  1 pcs  1 pcs  126.8  50 FMSI	MS8877 (Rear)  2 pcs  1 pcs  1 pcs  110  40 FMSI

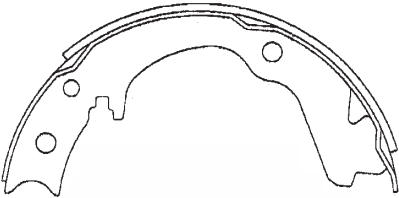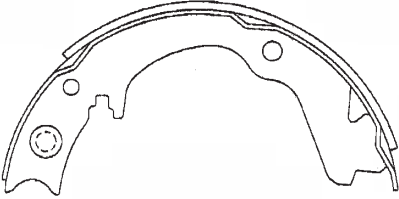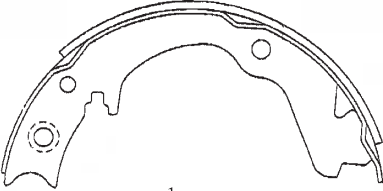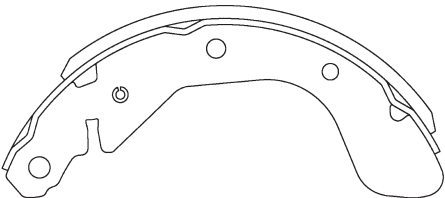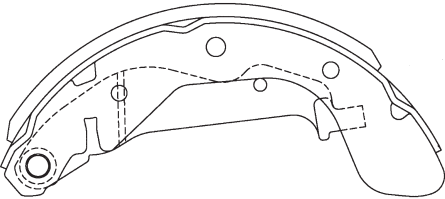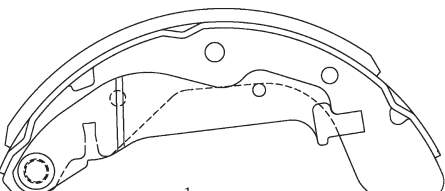1.MS8877 = MS9980

MS8878 (Rear) SUBARU Legacy Impreza  2 pcs  1 pcs  1 pcs	MS8881 (Rear) CHEV  2 pcs  1 pcs  1 pcs
R 84.5 30 FMSI 26298AA030 NN6019	R 99 35 FMSI 93740252
MS8879	
MS8880 (Rear) KIA Rio '00. 7-02. 7	

(Rear)

HYUNDAI Starex '03~on



52

FMS

58305-4AA30

(Rear)



146.4



52

FMSI

(Rear)



146.4



52

FMSI

MS8884

FMSI

MS8885



85.8

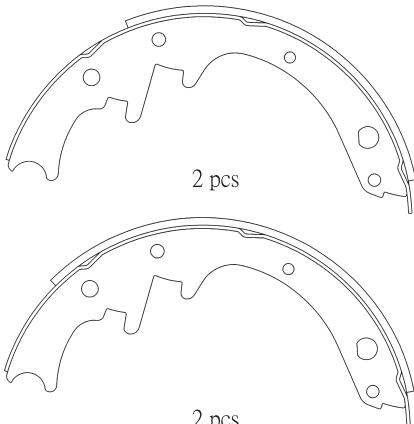
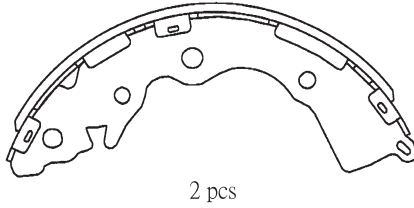
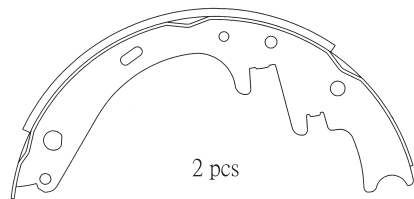
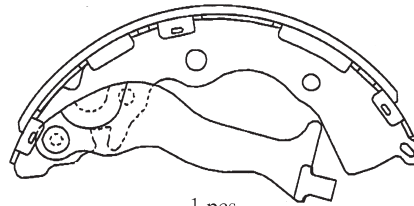
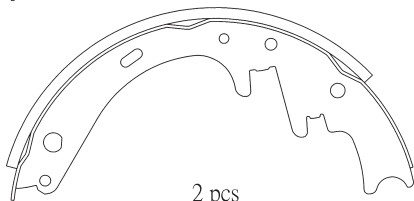
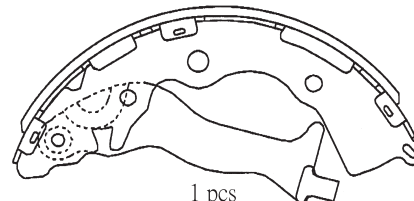
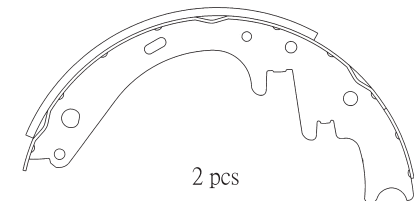
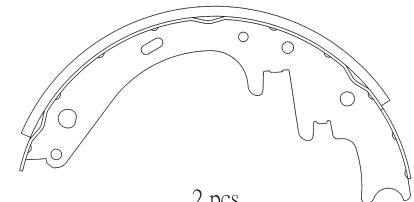
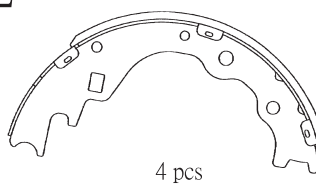
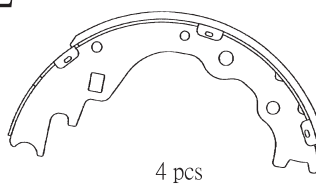











20

FMSI

1.MS8883 = MS8831

OTHERS


MS8886						MS8889 (Rear)						SUZUKI ALTO			
															
2 pcs						2 pcs									
2 pcs															
						126.4				46		FMSI			
MS8887						MS8890 (Rear)						HYUNDAI ATOS			
															
2 pcs						1 pcs									
															
2 pcs						1 pcs									
						139.5 141.4				58		FMSI			
MS8888						MS8891						CHEVROLET AVEO			
															
2 pcs						2 pcs									
															
2 pcs						2 pcs									
						140.3 141.6				63.5		FMSI			
MS8892 (Rear)						MS8892						HYUNDAI H10 PICK-UP 09-08			
															
4 pcs						4 pcs									
						129.7				50		FMSI			

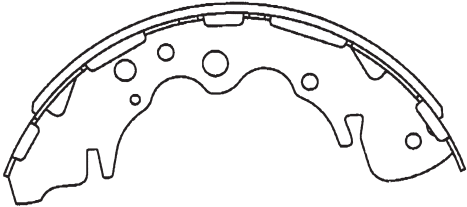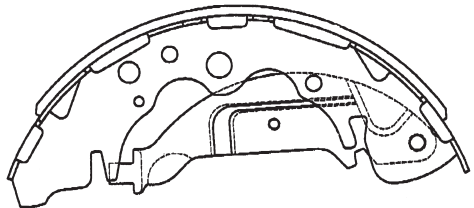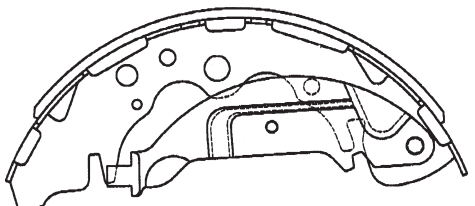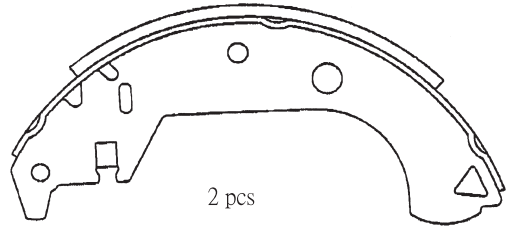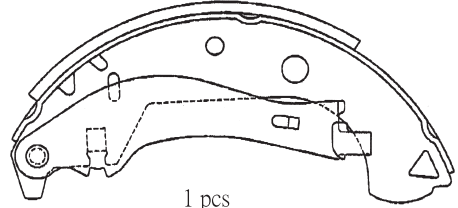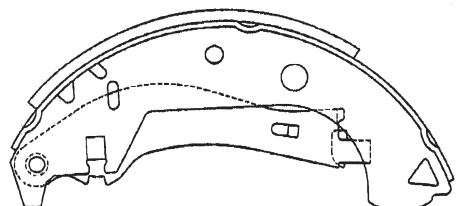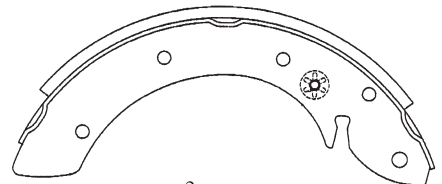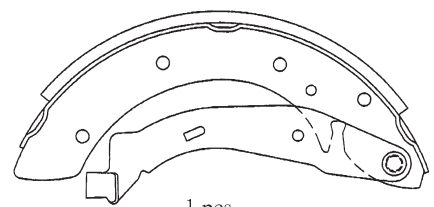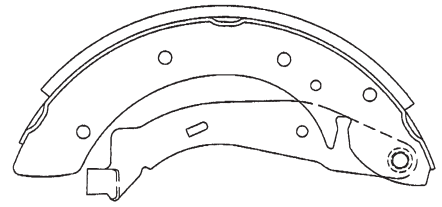MS8893  2 pcs  1 pcs  1 pcs	MS8896 FIAT DOBLO 01/05 (Rear)  2 pcs  1 pcs  1 pcs
R 126.6 54 FMSI	R 113.9 40 FMSI
MS8894 PEUGEOT 106-91/96 (Rear)	MS8897 PEUGEOT PARTNER 96/02 (Rear)  2 pcs
MS8895	 1 pcs  1 pcs
	R 114.3 40 FMSI


MS8898

(Rear)

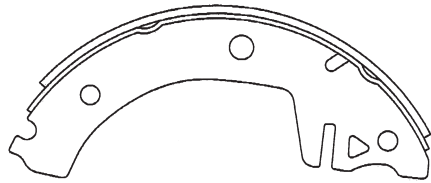
SKODA FAVORIT
FORMAN 88/94



2 pcs

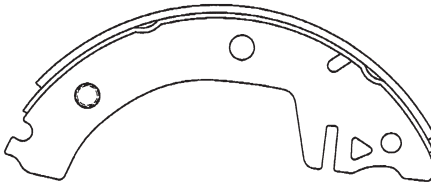

1 pcs

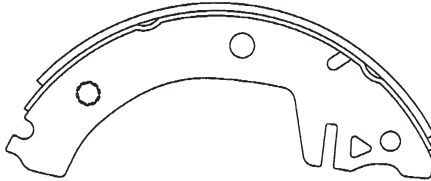

1 pcs



99.4




31


FMSI

MS8900

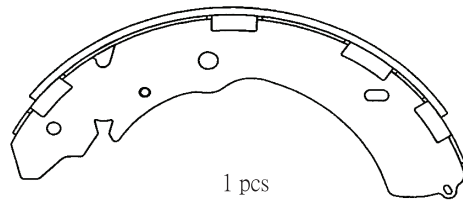
MB STRADA 08



1 pcs

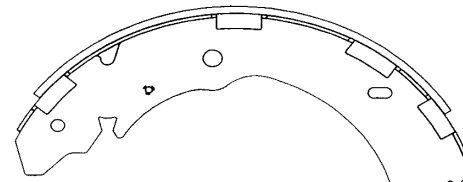

1 pcs

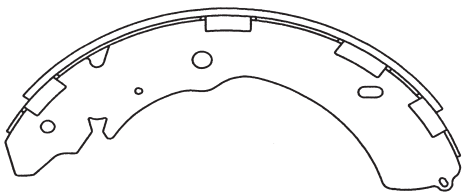

2 pcs



147.5



49

FMSI


MS8899




FMSI

MS8901

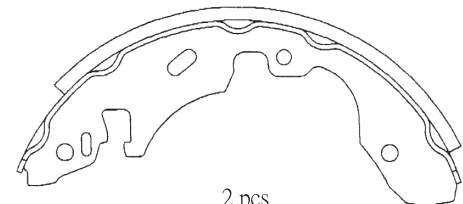
MONTERO 2000



2 pcs

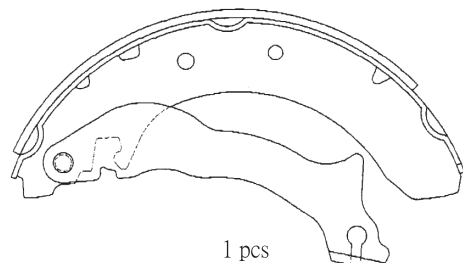

1 pcs

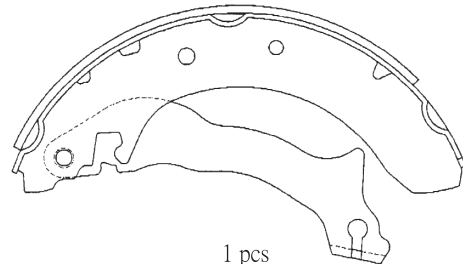

1 pcs



114.1
113.9

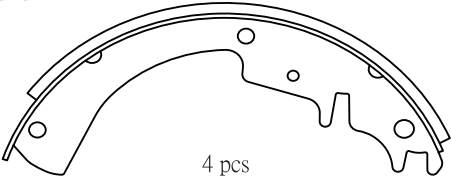
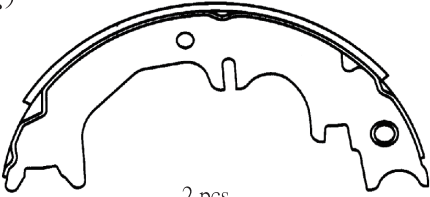
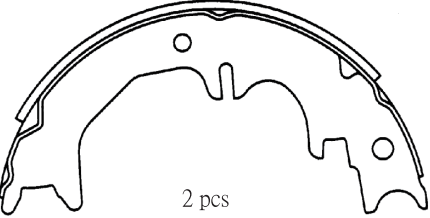
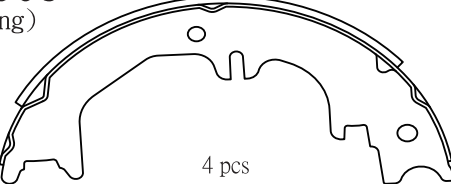
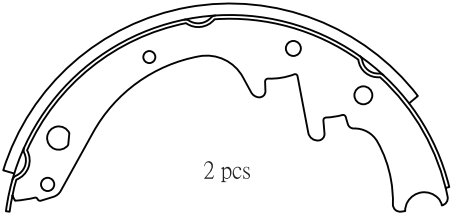
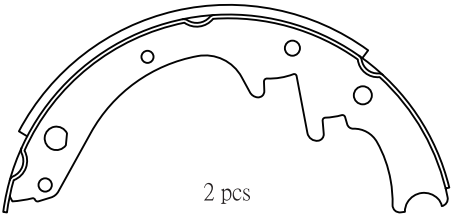
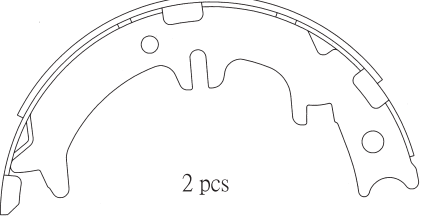
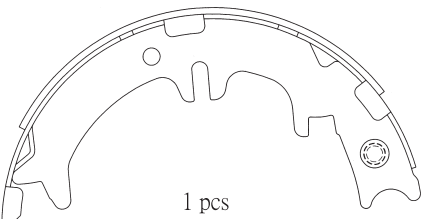
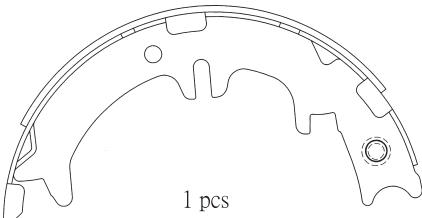
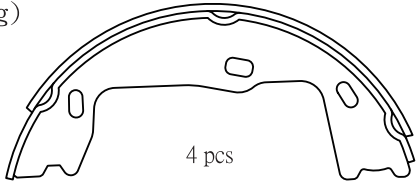


44










FMSI

OTHERS








1.MS8900 = MS6741





MS8902	MS8904 (Rear)  4 pcs HOLDEN Camira 80, Commodors
 160  120 FMSI	 114.3  50 FMSI N1385
MS8903 (Parking)  2 pcs  2 pcs TOYOTA Candcruiser 70	MS8905 (Parking)  4 pcs TOYOTA Candcruiser 80
 105  35 FMSI N1744	MS8906 (Rear)  2 pcs  2 pcs Ford Fairlane Falcon
MS8903A (Rear)  2 pcs  1 pcs  1 pcs TY AVENSIS PREVIA RAV4 LEXUS GS300	 127  44 FMSI N1271 MS8907 (Parking)  4 pcs HOLDEN Commodore, TOYOTA Lexcen
 95  25 FMSI	 80  25 FMSI N1669

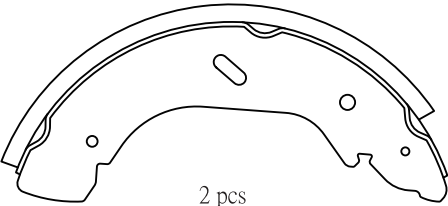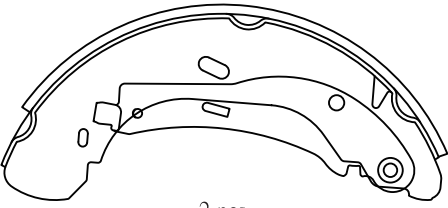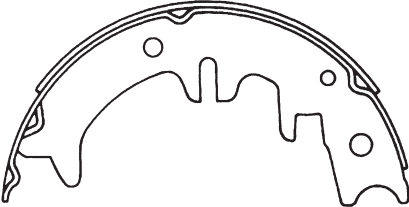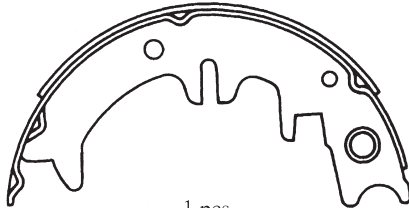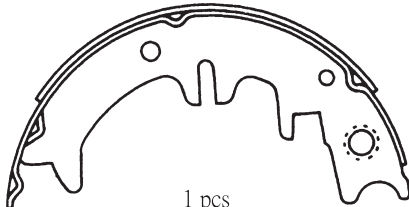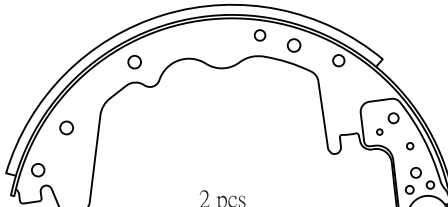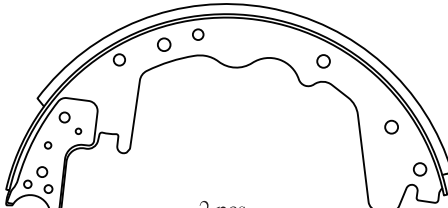
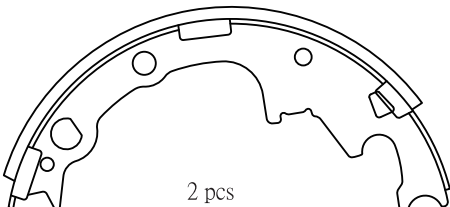
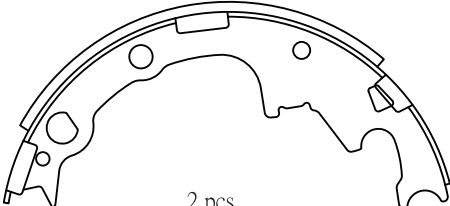
1.MS8902 = MS8938


MS8908 (Rear)  2 pcs  2 pcs  140  63 FMSI N1773		MS8912 (Parking)  2 pcs  1 pcs  1 pcs  85  30 FMSI	
MS8909 (Rear)  2 pcs  2 pcs  150  76 FMSI N1018			
MS8910 (Rear)  2 pcs  2 pcs  114.3  57 63 FMSI N1715			

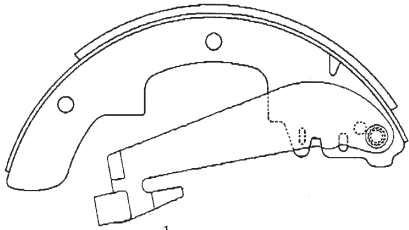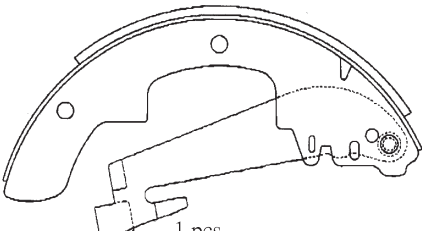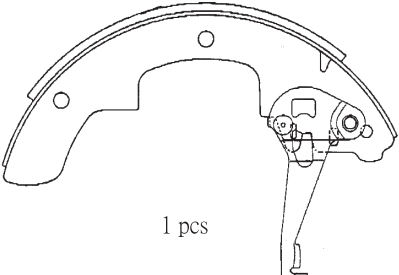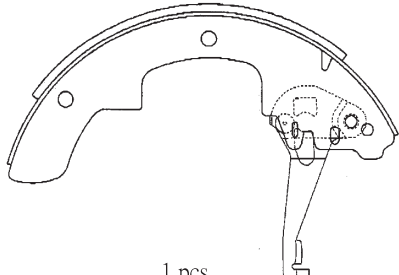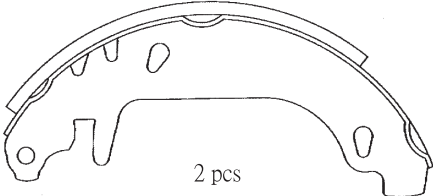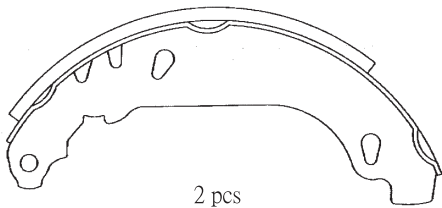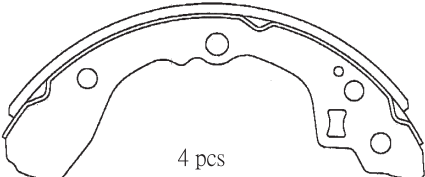
1.MS8912 = MS2308


MS8918 (Rear)  1 pcs  1 pcs  1 pcs  1 pcs R 114  40 FMSI	MS8928 (Rear)  2 pcs  2 pcs R 90  39.5 FMSI
MS8919 (Rear) R 124.5 128.3  50 FMSI	MS8930 (Rear)  R 147  55 FMSI
MS8927 (Rear)  4 pcs R 100  25 FMSI	NISSAN Navara

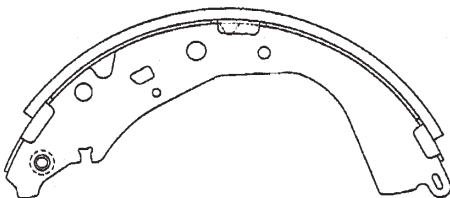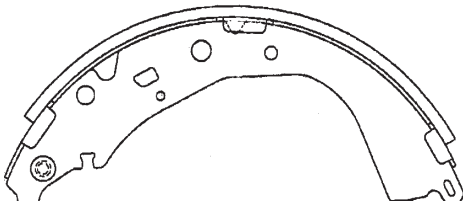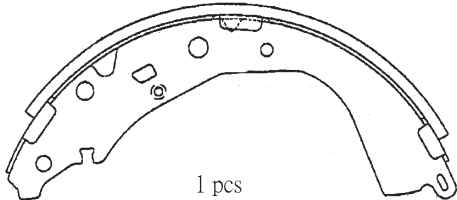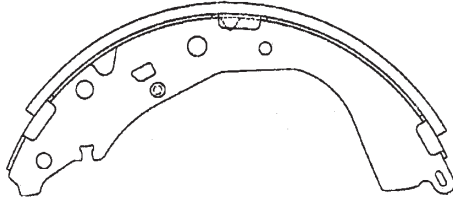MS8931 (Rear)		TOYOTA 4Runner, Tacoma, Tundra			
		1 pcs			
		1 pcs			
		1 pcs			
		1 pcs			
	147.5		50	FMSI	

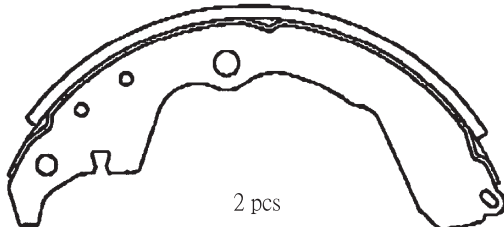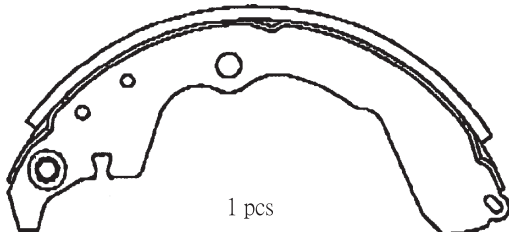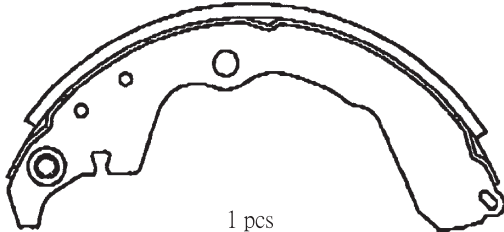MS8937 (Rrar)		TOYOTA Matrix '03-on			
		2 pcs			
		1 pcs			
		1 pcs			
	114.3		40	FMSI	

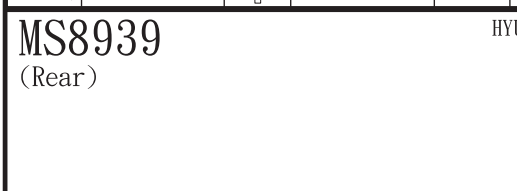MS8939 (Rear)		HYUNDAI Tucson			
					
	114.3		42	FMSI	

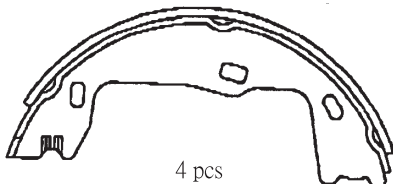MS8933 (Rear)		OPEL Astra '98-04, Omega '94-03, Vectra '88-95; SAAB 9-3 '98-02, 9-5 '97-on			
		4 pcs			
	80		25	FMSI	

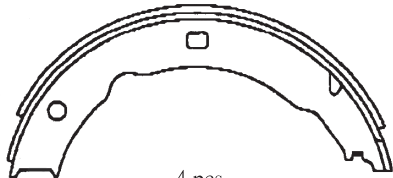MS8934 (Rear)		PEUGEOT 406 '95-04;			
		4 pcs			
	92.5		29	FMSI	

1.MS8938 = MS8902